

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL
ELECTOLOGGING REPORT

Ref No:- P- 224

Date:- 27-04-2023

NAME OF SITE

GRAM PANCHAYAT- Rasidpur

BLOCK- Jalesar

DISTT- Etah

NAME OF AGENCY

M/s ION Exchange India Limited
Etah



GROUND WATER SURVEY CONSULTANCY
Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy
Agra

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- RASIDPUR, BLOCK- JALESAR, DISTT-ETAH
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 105 mtrs. depth. and Logged depth 100 mtrs. at above site. Was drilled by M/s ION Exchange India Limited, Etah.

On the request of M/s ION Exchange India Limited, Etah. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 27.April.2023

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major Aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

Mud Resistivity = 12.29 Ohms.

Drilling Water Resistivity = 13.80 Ohms


Approx Water Level = 21 Mtr.

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 12	7	Fine sand	
3.	12 - 18	6	Clay kankar	
4.	18 - 30	12	Medium sand & kankar	Med to Marginally
5.	30 - 34	4	Clay kankar	
6.	34 - 40	6	Medium sand	Med to Marginally
7.	40 - 45	5	Clay kankar	
8.	45 - 55*	10	Medium sand	Med to Marginally
9.	55 - 58	3	Clay kankar	
10.	58 - 70*	12	Medium sand & kankar	Med to Marginally
11.	70 - 85	15	Clay kankar	
12.	85 - 90*	5	Medium sand	Med to Marginally
13.	90 - 94	4	Clay kankar	
14.	94 - 97	3	Fine sand	Med to Marginally
15.	97 - 100	3	Clay kankar	

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible Development of tube well.
3. The Quality of water is expected Medium to Marginally.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

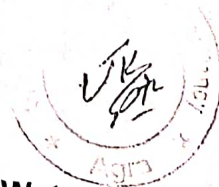


Ground Water Survey Consultancy

Rho a
 NI6 (SN)
 NS4(LIN)
 LAT
 Logging Details
 Instrument: J-000-00000
 Date: 01/21/22
 Time: 12:00
 Location: Gurgaon, India

Logger's Name:
 IGIS/01/21-22

Logger Model:
 DMAPL-2

Logger Owned by:
 GROUND WATER SURVEY CONSULTANCY
 AGRA, UP India

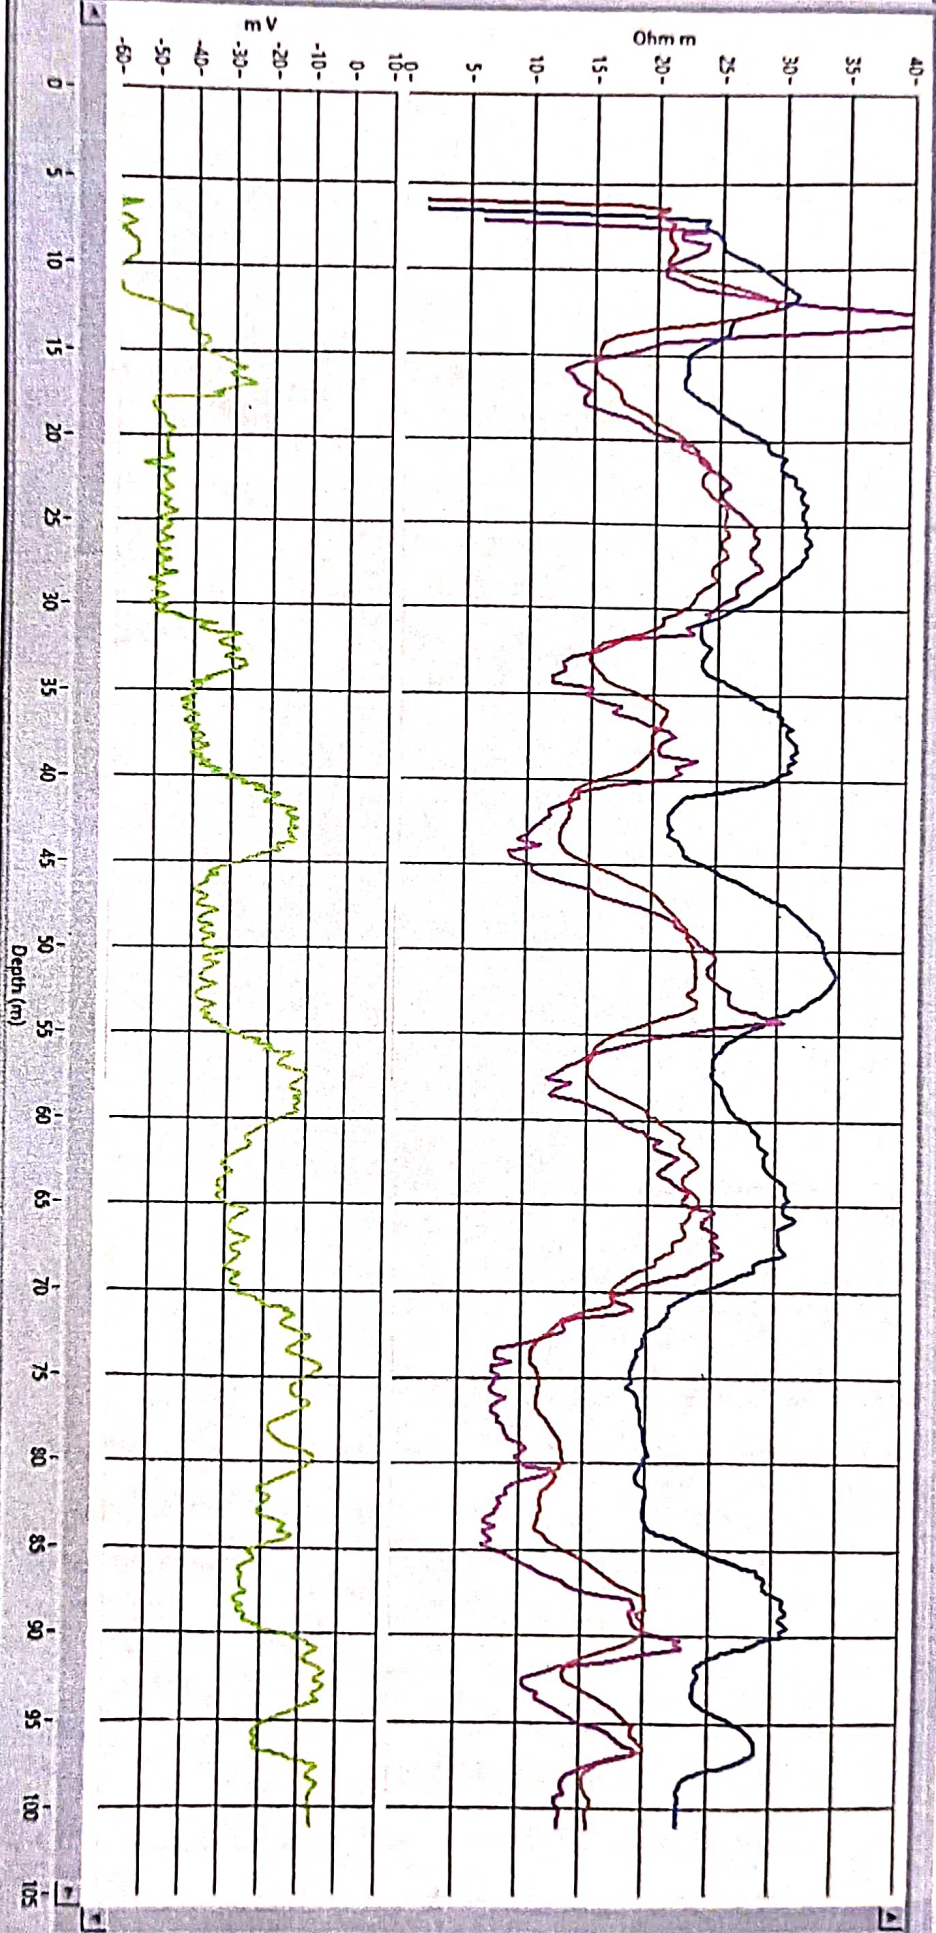

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- RASIDPUR, BLOCK- JALESAR, DISTT-ETAH
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 105 mtrs. depth. and Logged depth ~~100~~ mtrs. at above site. Was drilled by M/s ION Exchange India Limited, Etah.

On the request of M/s ION Exchange India Limited, Etah. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 27.April.2023

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major Aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

Mud Resistivity = ~~12.29~~ Ohms.

Drilling Water Resistivity = ~~13.80~~ Ohms.

Approx Water Level = 21 Mtr.

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 12	7	Fine sand	
3.	12 - 18	6	Clay kankar	
4.	18 - 30	12	Medium sand & kankar	Med to Marginally
5.	30 - 34	4	Clay kankar	
6.	34 - 40	6	Medium sand	Med to Marginally
7.	40 - 45	5	Clay kankar	
8.	45 - 55*	10	Medium sand	Med to Marginally
9.	55 - 58	3	Clay kankar	
10.	58 - 70*	12	Medium sand & kankar	Med to Marginally
11.	70 - 85	15	Clay kankar	
12.	85 - 90*	5	Medium sand	Med to Marginally
13.	90 - 94	4	Clay kankar	
14.	94 - 97	3	Fine sand	Med to Marginally
15.	97 - 100	3	Clay kankar	

Sy No 10-63-70
(7m)
P. Gh.

Ground Water Survey Consultancy



- Logging performed as per SWSM guidelines - Groundwater quality