

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTROLOGGING REPORT**

Ref No:-A-2106

Date:- 03-11-2023

NAME OF SITE

GRAM PANCHAYAT- Rajthal

BLOCK- Islamnagar

DISTT- Badaun

NAME OF AGENCY

M/s PNC-SPML-JV
Badaun



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

Handwritten signature

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- RAJTHAL, BLOCK- ISLAMNAGAR,
DISTT- BADAUN
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 140 mtrs. depth. and Logged depth 135 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 03.Nov.2023.


Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 15	10	Dry sand	
3.	15 - 25	10	Clay kankar	
4.	25 - 30	5	Fine sand	Medium
5.	30 - 35	5	Clay kankar	
6.	35 - 38	3	Fine to Medium sand	Medium
7.	38 - 40	2	Clay kankar	
8.	40 - 58*	18	Medium sand	Medium
9.	58 - 64	6	Clay kankar	
10.	64 - 75*	11	Medium sand	Medium
11.	75 - 80	5	Clay kankar	
12.	80 - 110*	30	Medium sand	Medium
13.	110 - 123	13	Clay kankar	
14.	123 - 133*	10	Medium sand	Medium
15.	133 - 135	2	Clay kankar	

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

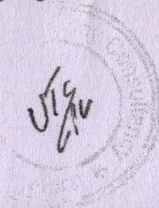

Ground Water Survey Consultancy

Page 2

N16 (SN)

MS4111

LAT

Logging Details

LOGGING DETAILS AND
LOGGING INFORMATION
DATE: 05/01/21
TIME: 10:30 AM
PROJECT: UTS
SITE: UTS
OPERATOR: S.M. AG

Logger E No

IGS/S/01/21-22

SP (m V)


SP (m V)

Logger Model

DMPL-2

Logger Date of

GROUND WATER
SURVEY
CONSULTANCY
AGRA, UP, India

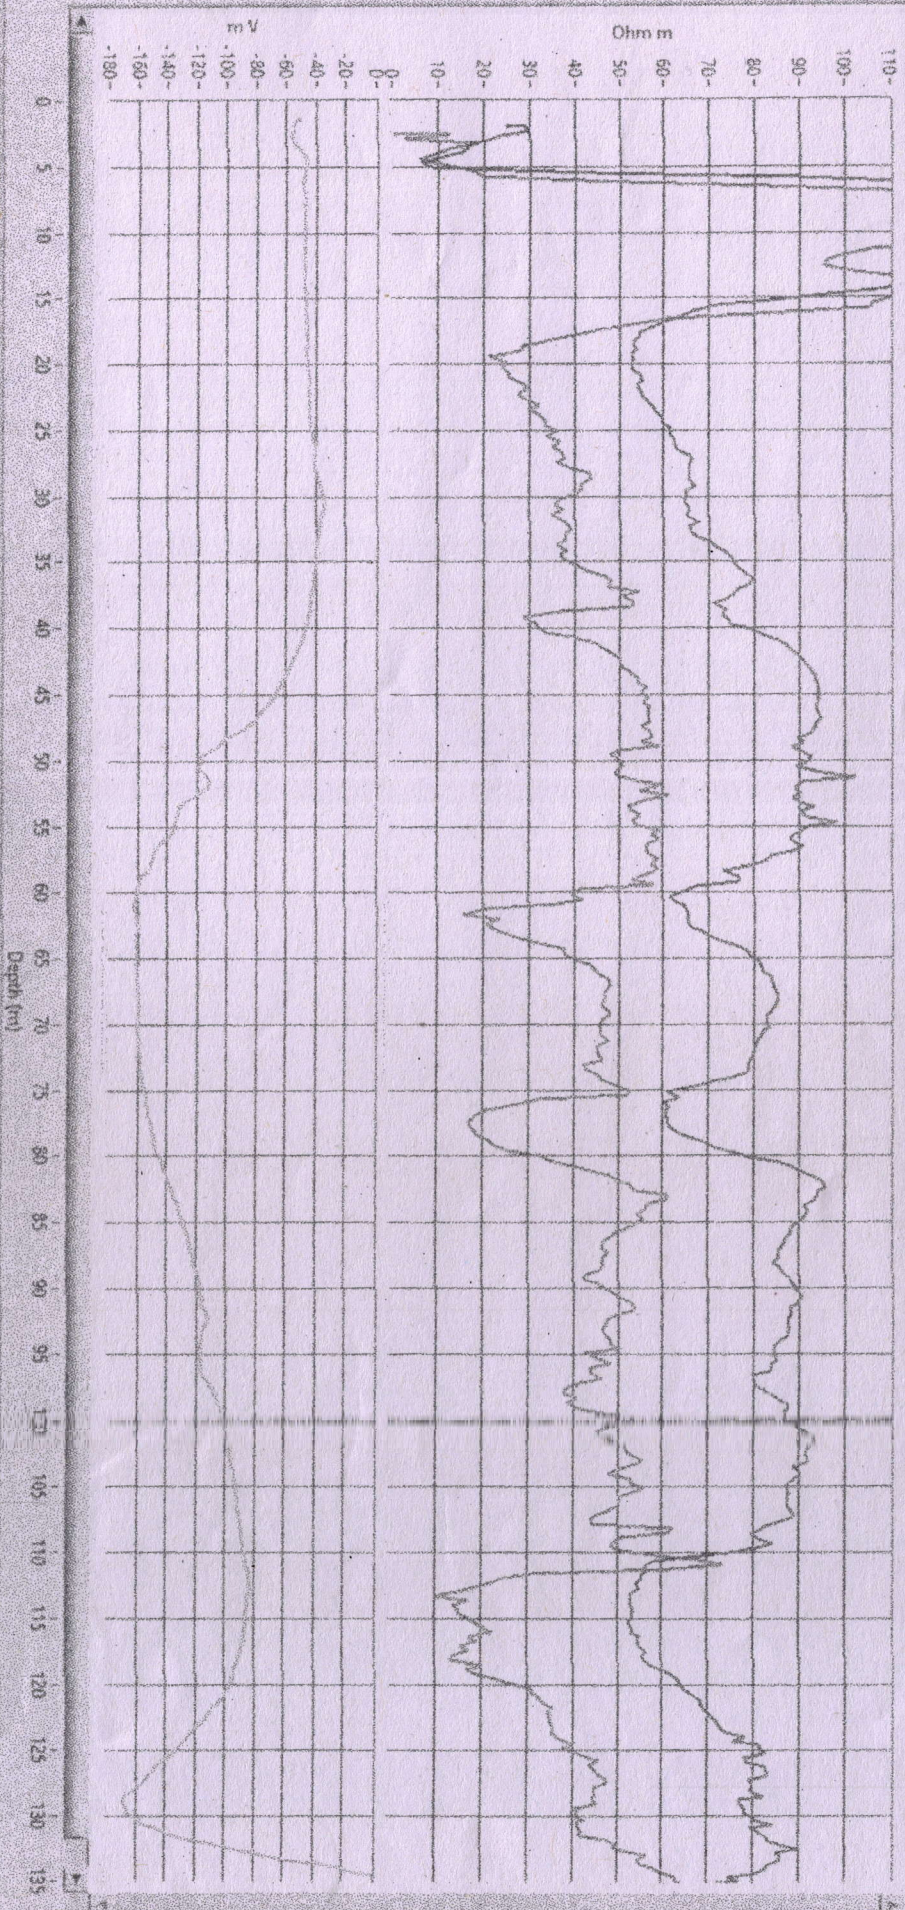

UTS
OR