

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTROLOGGING REPORT**

Ref No:-B-2967

Date:- 23-01-2024

NAME OF SITE

GRAM PANCHAYAT- Shahnagar Patparganj BOCK- Dahagawan DISTT- Badaun

NAME OF AGENCY

M/s PNC-SPML-JV
Badaun



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

Agra
JV

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- SHAHNAGAR PATPARGANJ, BLOCK- DAHAGAWAN,
DISTT- BADAUN
UNDER
JAL JIVAN MISSION

Introduction :


A Deep bore hole was drilled 130 mtrs depth and Logged depth 130 mtrs at above site. Was drilled by M/S PNC-SPML-JV, Badaun

On the request of M/S PNC-SPML-JV, Badaun a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 23 Jan 2024

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table :-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 15	10	Dry sand	
3.	15 - 18	3	Clay kankar	
4.	18 - 21	3	Fine sand	
5.	21 - 28	7	Clay kankar	
6.	28 - 38	10	Medium sand	Medium
7.	38 - 45	7	Clay kankar	
8.	45 - 48	3	Fine sand	Medium
9.	48 - 64	16	Clay kankar	
10.	64 - 80*	16	Medium sand	Medium
11.	80 - 85	5	Clay kankar	
12.	85 - 106*	21	Medium sand	Medium
13.	106 - 120	14	Clay kankar	
14.	120 - 130*	10	Medium sand	Medium


Ground Water Survey Consultancy

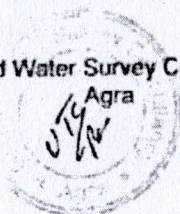

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geologist

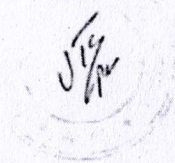

Report No. 11
 Date: 10/10/11
 Project Name: SP (m V)
 DART-2
 Report Number: 11
 Ground Water Survey Consultancy
 Aqua Tap India
 India

