

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTOLOGGING REPORT**

Ref No:-A-1693

Date:- 26-09-2023

NAME OF SITE

GRAM PANCHAYAT- Mohammadpur BLOCK- Sahaswan DISTT- Badaun

NAME OF AGENCY


M/s PNC-SPML-JV
Badaun



GROUND WATER SURVEY CONSULTANCY
Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

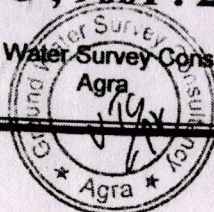

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- MOHAMMADPUR, BLOCK- SAHASWAN, DISTT- BADAUN
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 140 mtrs. depth. and Logged depth 140 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 26.Sep.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 8	3	Clay	
3.	8 - 15	7	Medium sand	
4.	15 - 24	9	Clay kankar	
5.	24 - 32	8	Medium sand	Medium
6.	32 - 50	18	Clay kankar	
7.	50 - 62*	12	Medium sand	Medium
8.	62 - 66	4	Clay kankar	
9.	66 - 74*	8	Medium sand	Medium
10.	74 - 85	11	Clay kankar	
11.	85 - 93*	8	Medium sand	Medium
12.	93 - 106	13	Clay kankar	
13.	106 - 120*	14	Medium sand	Medium
14.	120 - 126	6	Clay kankar	
15.	126 - 131*	5	Fine to Medium sand	Medium
16.	131 - 137	6	Clay kankar	
17.	137 - 140*	3	Fine to Medium sand	Medium

Ground Water Survey Consultancy



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

Rho a
 M16 (SN)
 N64(Q/N)
 LAT

Logging Details:
 Logging Co: Mohanmatar
 Ultra Rec: Saranwar Dist
 Beddar
 UP: GORANGUP
 26 546 2023
 14.30
 Uthman Gupta (AG)

Logger S No: _____
 IGS/S/O2/22-23

SP (m V)
 Logger Model: _____
 DNPR-2
 Logger Owned by: _____

GROUND WATER
 SURVEY
 CONSULTANCY
 AGRA, UP, INDIA

