

GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTROLOGGING REPORT

B-573

Ref No:-P- 403

Date:- 17-05-2023

NAME OF SITE

GRAM PANCHAYAT- Narupur Katka

BLOCK- Bijauli

DISTT- Aligarh

NAME OF AGENCY

M/s Kalpataru Power Transmission Limited
Aligarh




GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy
Agra

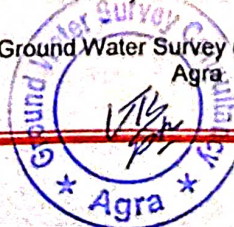

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- NARUPOR KATKA, BLOCK- BIJAULI, DISTT- ALIGARH UNDER JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 128 mtrs. at above site. Was drilled by M/s Kalpataru Power Transmission limited, Aligarh.

On the request of M/s Kalpataru Power Transmission limited, Aligarh. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 17.May.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major Aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

Mud Resistivity = 15.62 Ohms.

Drilling Water Resistivity = 16.86 Ohms.

Approx Water Level = 9 Mtr.

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 16	11	Fine sand	
3.	16 - 22	6	Clay kankar	
4.	22 - 31	9	Fine to Medium sand	Medium
5.	31 - 35	4	Clay kankar	
6.	35 - 53	18	Medium sand	Medium
7.	53 - 59	6	Clay kankar	
8.	59 - 65*	6	Fine to Medium sand	Medium
9.	65 - 75	10	Clay kankar	
10.	75 - 86*	11	Medium sand	Medium
11.	86 - 90	4	Clay kankar	
12.	90 - 98*	8	Fine to Medium sand	Medium
13.	98 - 103	5	Clay kankar	
14.	103 - 114*	11	Medium sand	Medium
15.	114 - 120	6	Clay kankar	
16.	120 - 123	3	Fine sand	Medium
17.	123 - 128	5	Clay kankar	


Ground Water Survey Consultancy



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible Development of tube well.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

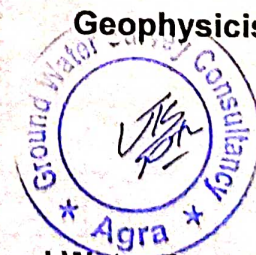

Ground Water Survey Consultancy

Rho a
 N16 (SN)
 N64 (LN)
 LAT

Gp. Narupor Katka,
 Block-Befoil, Dist.
 Aligarh,
 LOGGILGup
 17 May 2023
 19:45

SP (m V)

