

# GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

## GEO-PHYSICAL WELL ELECTOLOGGING REPORT

13-572  
Ref No:-P- 402

Date:- 17-05-2023

### NAME OF SITE

GRAM PANCHAYAT- Maharajanj

BLOCK- Chandaus

DISTT- Aligarh

### NAME OF AGENCY

M/s Kalpataru Power Transmission Limited  
Aligarh



## GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.  
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006  
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy  
Agra



# REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- MAHARAJAGANJ, BLOCK- CHANDAU, DISTT- ALIGARH  
UNDER  
JAL JIVAN MISSION

## Introduction :

A Deep bore hole was drilled 115 mtrs. depth. and Logged depth 112 mtrs. at above site. Was drilled by M/s Kalpataru Power Transmission limited, Aligarh.

On the request of M/s Kalpataru Power Transmission limited, Aligarh. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 17.May.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major Aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-


Mud Resistivity = 15.80 Ohms.

Drilling Water Resistivity = 16.23 Ohms.

Approx Water Level = 9 Mtr.

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 8	3	Clay kankar	
3.	8 - 30	22	Fine to medium sand	Medium
4.	30 - 35	5	Clay kankar	
5.	35 - 45*	10	Fine to Medium sand	Medium
6.	45 - 50	5	Clay kankar	
7.	50 - 55	5	Fine sand	Med to Marginally
8.	55 - 59	4	Clay kankar	
9.	59 - 67*	8	Medium sand	Med to Marginally
10.	67 - 72	5	Clay kankar	
11.	72 - 87*	15	Sand & kankar	Med to Marginally
12.	87 - 92	5	Clay kankar	
13.	92 - 97	5	Fine sand	Med to Marginally
14.	97 - 101	4	Clay kankar	
15.	101 - 106*	5	Fine to Medium sand	Med to Marginally
16.	106 - 112	6	Clay kankar	

Ground Water Survey Consultancy  
Agra

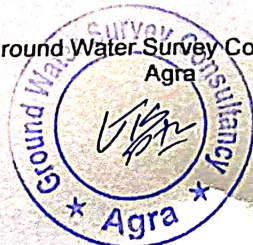

**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible Development of tube well.
3. The Quality of water is expected Medium to Marginally.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geophysicist**



**Ground Water Survey Consultancy**

Rho a  
N16 (SN)  
N64(LN)  
LAT

Gp. Maharajgarh,  
Block. Chandaus,  
Dist. Aligarh,  
LOGGINKup  
17 May 2023  
22.29

SP (mV)

