

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTROLOGGING REPORT**

Ref No:-B-3110

Date:- 20-02-2024

NAME OF SITE

GRAM PANCHAYAT- Jogiya Zone -2 BLOCK- Jamunaha DISTT- Shravasti

NAME OF AGENCY

M/s Vishwanath Project Limited
Shravasti



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy



REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- JOGIYA ZONE -2, BLOCK- JAMUNAHA, DISTT- SHRAVASTI UNDER JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 165 mtrs. depth. and Logged depth 165 mtrs. at above site. Was drilled by M/s Vishwanath Project Limited, Shravasti.

On the request of M/s Vishwanath Project Limited, Shravasti. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 20.Feb.2024.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major Aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

Mud Resistivity = 16.13 Ohms.

Drilling Water Resistivity = 19.13 Ohms.

Approx Water Level = 3 Mtr


S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 10	5	Clay kankar	
3.	10 - 13	3	Fine sand	
4.	13 - 27	14	Clay kankar	
5.	27 - 32	5	Medium sand	Good
6.	32 - 45	13	Clay kankar	
7.	45 - 47	2	Fine to Medium sand	Good
8.	47 - 51	4	Clay kankar	
9.	51 - 60*	9	Medium sand	Good
10.	60 - 65	5	Clay kankar	
11.	65 - 70	5	Fine sand & kankar	Good
12.	70 - 80	10	Clay kankar	
13.	80 - 85	5	Fine to Medium sand	Good
14.	85 - 95	10	Clay kankar	
15.	95 - 100	5	Fine to Medium sand	Good
16.	100 - 105	5	Clay kankar	
17.	105 - 111*	6	Medium sand	Good
18.	111 - 116	5	Clay kankar	
19.	116 - 122*	6	Medium course sand	Good
20.	122 - 130	8	Clay kankar	
21.	130 - 145*	15	Medium sand	Good
22.	145 - 148	3	Clay kankar	
23.	148 - 155*	7	Medium sand	Good
24.	155 - 160	5	Clay kankar	
25.	160 - 165*	5	Medium sand	Good

Ground Water Survey Consultancy



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible Development of tube well.
3. The Quality of water is expected Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

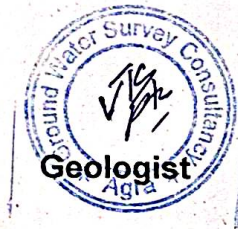

Rho a

N 16(SN)
N 64 (LN)
LAT

Location: Loggona V. Region Zone 2
Block: Jhansi Region Distt:
State: UP
Log No.: UP/LOGS/NG/24
Date: 20 Feb 2024
Time: 17:52
Observer: Vishwan Gaur (KS)
Well Depth:

Logger SI No.: GIS/S/O/21-22

Logger Model: SP

DMP1-2

Logger Owned by: GROUND WATER SURVEY CONSULTANCY - AGRA INDIA

