

GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTROLOGGING REPORT

Ref No:-B-2063

Date:- 15-10-2023

NAME OF SITE

GRAM PANCHAYAT- Bichoula Tappa Jamani BLOCK- Sahaswan DISTT- Badaun

NAME OF AGENCY

M/s PNC-SPML-JV
Badaun



GROUND WATER SURVEY CONSULTANCY


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

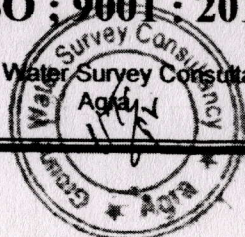

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- BICHOULA TAPPA JAMANI, BLOCK- SAHASWAN,
DISTT- BADAUN
UNDER
JAL JIVAN MISSION

Introduction :


A Deep bore hole was drilled 140 mtrs. depth. and Logged depth 138 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 15.Oct.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 12	7	Dry sand	
3.	12 - 24	12	Clay kankar	
4.	24 - 42	18	Medium sand	Med to Good
5.	42 - 58	16	Clay kankar	
6.	58 - 65*	7	Fine to Medium sand	Med to Good
7.	65 - 73	11	Clay kankar	
8.	73 - 80*	7	Fine to Medium sand	Med to Good
9.	80 - 86	6	Clay kankar	
10.	86 - 97*	11	Medium sand	Med to Good
11.	97 - 115	18	Clay kankar	
12.	115 - 126*	11	Medium sand	Med to Good
13.	126 - 138	12	Clay kankar	

Ground Water Survey Consultancy
Agra

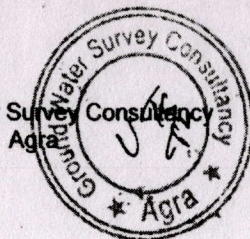

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium to Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

