

**GROUND WATER SURVEY CONSULTANCY**  
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL  
ELECTROLOGGING REPORT**

Ref No:-A-2206

Date:- 19-11-2023

**NAME OF SITE**

GRAM PANCHAYAT- Musajhag

BLOCK- Jagat

DISTT- Badaun

**NAME OF AGENCY**

M/s PNC-SPML-JV  
Badaun



**GROUND WATER SURVEY CONSULTANCY**


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy

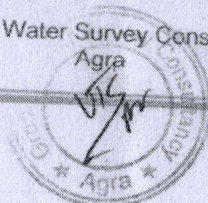

# REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- MUSAJHAG, BLOCK- JAGAT, DISTT- BADAUN  
UNDER  
JAL JIVAN MISSION

## Introduction :


A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 19.Nov.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 10	5	Dry sand	
3.	10 - 14	4	Clay kankar	
4.	14 - 17	3	Fine to Medium sand	Medium
5.	17 - 23	6	Clay kankar	
6.	23 - 34	11	Medium sand & kankar	Medium
7.	34 - 37	3	Clay kankar	
8.	37 - 45	8	Medium sand	Medium
9.	45 - 49	4	Clay kankar	
10.	49 - 72*	23	Medium sand & kankar	Medium
11.	72 - 85	13	Clay kankar	
12.	85 - 90*	5	Medium sand	Medium
13.	90 - 105	15	Clay kankar	
14.	105 - 119*	14	Medium sand & kan	Medium
15.	119 - 130	11	Clay kankar	

Ground Water Survey Consultancy

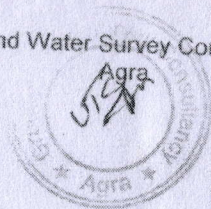

**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geophysicist**



**Ground Water Survey Consultancy**

Rho a  
N16 (SN)  
N16 (LN)  
LAT

Logging of Watering Block  
Jagan Dohi Buda  
UP, LOCKHART  
19 Nov 2012  
22:01  
Uttarakhand (Kali)

Logger Site No  
IGIS/S/02/22-23

SP (m V)

Logger Model  
DMPL-2

Logger Owned by  
GROUND WATER  
SURVEY  
CONSULTANCY  
ASDA, UP, INDIA

