

# GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

## GEO-PHYSICAL WELL ELECTROLOGGING REPORT

Ref No:-A-2365

Date:-15-12-2023

### NAME OF SITE

GRAM PANCHAYAT- Paiga Bhikampur

BLOCK- Bisauli

DISTT- Badaun

### NAME OF AGENCY

M/s PNC-SPML-JV  
Badaun



### GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.


112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy

Agra

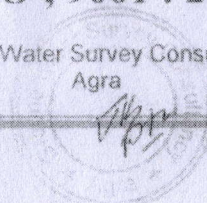

# REPORT ON GEOPHYSICAL WELL LOGGING AT

## GRAM PANCHAYAT- PAIGA BHIKAMPUR, BLOCK- BISAULI, DISTT- BADAUN UNDER JAL JIVAN MISSION

### Introduction :

A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 15.Dec.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 18	13	Dry sand	
3.	18 - 30	12	Clay kankar	
4.	30 - 47	17	Medium sand	Medium
5.	47 - 54	7	Clay kankar	
6.	54 - 58*	4	Medium sand	Medium
7.	58 - 70	12	Clay kankar	
8.	70 - 95*	25	Medium sand	Medium
9.	95 - 100	5	Clay kankar	
10.	100 - 106*	6	Medium sand	Medium
11.	106 - 110	4	Clay kankar	
12.	110 - 123*	13	Medium sand	Medium
13.	123 - 128	5	Clay kankar	
14.	128 - 130*	2	Medium sand	Medium

Ground Water Survey Consultancy

Agra



**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geologist**



Rho a  
M16 (SM)  
MAGLUM  
LAT

Logging Details  
Project: 01101  
Date: 12/12/2011  
12:34:11  
Operator: Gopal Singh

Log No: 21-22  
IGRIS/SM/21-22

SP (m V)  
Logger Name: BHUP1-2  
Logger Checked by:  
GROUND WATER SURVEY CONSULTANCY AGRA, INDIA

