

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL
ELECTROLOGGING REPORT

Ref No:- 571

Date:- 28-07-2022

NAME OF SITE

Gram Panchayat- Hashimpur Khera

BLOCK- Kanth

DISTT- Shahjahanpur

NAME OF AGENCY


M/s NCC Ltd.
Shahjahanpur



GROUND WATER SURVEY CONSULTANCY
Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

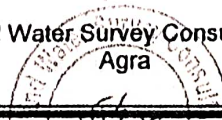

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- HASHIMPUR KHERA, BLOCK- KANTH
DISTT- SHAHJAHANPUR
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 122 mtrs. depth. and Logged depth 120 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 28.July.2022.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major equifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

| S.No. | Depth range(m) | Thickness(m) | Lithology | Expected Water Quality |
|-------|----------------|--------------|----------------------|------------------------|
| 1. | 0 - 5 | 5 | Surface soil | |
| 2. | 5 - 12 | 7 | Fine sand | |
| 3. | 12 - 16 | 4 | Clay kankar | |
| 4. | 16 - 24 | 8 | Medium sand | Good |
| 5. | 24 - 31 | 7 | Clay kankar | |
| 6. | 31 - 40 | 9 | Medium sand | Good |
| 7. | 40 - 43 | 3 | Clay kankar | |
| 8. | 43 - 59* | 16 | Medium sand | Good |
| 9. | 59 - 62 | 3 | Clay kankar | |
| 10. | 62 - 83* | 21 | Medium sand & Kankar | Good |
| 11. | 83 - 92 | 9 | Clay kankar | |
| 12. | 92 - 100* | 8 | Medium sand | Good |
| 13. | 100 - 120 | 20 | Sandy clay & Kankar | |

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting starta chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Good.
4. Expected discharge is 900 to 1000 L.P.M.
5. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
6. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

Rho a
 N16 (SN)
 N64(LIN)
 LAT

20774 V. HARRINGTON
 0704 E ROCKWELL DR
 SHELBYVILLE
 KY 40381
 231-1101
 1800
 Ground Water

SP (mV)

