

GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTROLOGGING REPORT

Ref No:-B-478

Date:- 13-05-2023

NAME OF SITE

GRAM PANCHAYAT- Mohshampur

BLOCK- Samrer

DISTT- Badaun

NAME OF AGENCY

M/s PNC-SPML-JV
Badaun



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.


112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

Agra

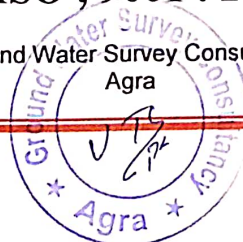

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- MOHSHAMPUR, BLOCK- SAMRER,
DISTT.- BADAUN

UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 13.May.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 10	5	Clay kankar	
3.	10 - 17	7	Fine sand	
4.	17 - 22	5	Clay kankar	
5.	22 - 28	6	Sandy clay	
6.	28 - 36	8	Fine to Medium sand	Good
7.	36 - 42	6	Clay kankar	
8.	42 - 71*	29	Medium sand & kankar	Good
9.	71 - 74	3	Clay kankar	
10.	74 - 81*	7	Medium sand	Good
11.	81 - 85	4	Clay kankar	
12.	85 - 92*	7	Medium sand	Good
13.	92 - 107	15	Clay kankar	
14.	107 - 130*	23	Medium sand & kankar	Good


Ground Water Survey Consultancy



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

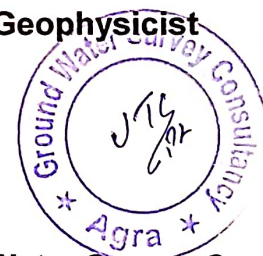

Ground Water Survey Consultancy

Rho a
 NI6 (SN)
 NS4(LN)
 LAT
 Logging Details
 Logging Unit: NI6 (SN)
 Date: 13 May 2023
 Time: 18:02
 Location: Agra (INDIA)

Logger S No: [GIS/S/03/21-22]

Logger Model: DMP-L-2
 Logger Owned by: GROUND WATER SURVEY CONSULTANCY - AGRA INDIA

