

**GROUND WATER SURVEY CONSULTANCY**  
**GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS**

**GEO-PHYSICAL WELL**  
**ELECTOLOGGING REPORT**

Ref No:-B-24

Date:- 06-04-2024

NAME OF SITE 1111

Gram Panchayat- Chaparkaura

BLOCK- Dataganj

DISTT- Badaun

NAME OF AGENCY

M/s PNC-SPML-JV  
Badaun



**GROUND WATER SURVEY CONSULTANCY**

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy

Agra

*[Handwritten signature]*

# REPORT ON GEOPHYSICAL WELL LOGGING AT

## GRAM PANCHAYAT- CHAPARKAURA, BLOCK- DATAGANJ, DISTT- BADAUN UNDER JAL JIVAN MISSION

### Introduction :

A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 06.April.2024.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 8	3	Clay kankar	
3.	8 - 12	4	Fine sand	
4.	12 - 23	11	Clay kankar	
5.	23 - 35	12	Medium sand	Medium
6.	35 - 40	5	Clay kankar	
7.	40 - 56	16	Medium sand	Medium
8.	56 - 65	9	Clay kankar	
9.	65 - 92*	27	Medium sand & kankar	Medium
10.	92 - 104	12	Clay kankar	
11.	104 - 108*	4	Fine to Medium sand	Medium
12.	108 - 116	8	Clay kankar	
13.	116 - 120	4	Fine sand	Medium
14.	120 - 130	10	Clay kankar	


Ground Water Survey Consultancy



**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tube well.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geologist**

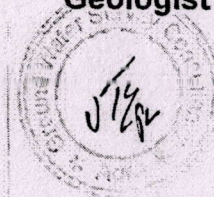

Rho a  
 NIS (SNT)  
 NS4(LUN)  
 LAT

Logging Details:  
 Logging by: G. K. K. K.  
 Date: 08 Apr 2014  
 20:23  
 Vial:

Logger S No:  
 IGSS/01/21-22

SP (m V)

Logger Model:  
 DMAPL-2

Logger Owned by:  
 GROUND WATER  
 SURVEY  
 CONSISTENCY  
 AGRU, UP, India

