

GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTOLOGGING REPORT

Ref No:-B- 1713

Date:- 15-09-2023

NAME OF SITE

GRAM PANCHAYAT- Bhagot

BLOCK- Khekda

DISTT- Baghpat

NAME OF AGENCY

LC Infra Projects Pvt. Ltd.
Baghpat



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy



REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- BHAGOT, BLOCK- KHEKDA, DISTT- BAGHPAT UNDER JAL JIVAN MISSION

Introduction :


A Deep bore hole was drilled 145 mtrs. depth. and Logged depth 135 mtrs. at above site. Was drilled by M/s LC Infra Projects Pvt. Ltd.,Baghpat.

On the request of M/s LC Infra Projects Pvt. Ltd. Baghpat. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 15.Sep.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 13	8	Clay kankar	
3.	13 - 20	7	Fine sand	
4.	20 - 30	10	Clay kankar	
5.	30 - 33	3	Fine to Medium sand	Medium
6.	33 - 37	4	Clay kankar	
7.	37 - 54	17	Medium sand	Medium
8.	54 - 62	8	Clay kankar	
9.	62 - 79*	17	Medium sand & kankar	Medium
10.	79 - 90	11	Clay kankar	
11.	90 - 95*	5	Fine to Medium sand	Medium
12.	95 - 100	5	Clay kankar	
13.	100 - 108*	8	Medium sand	Medium
14.	108 - 114	6	Clay kankar	
15.	114 - 117*	3	Fine to Medium sand	Medium
16.	117 - 123	6	Clay kankar	
17.	123 - 125	2	Fine sand	Medium
18.	125 - 135	10	Clay kankar	

Ground Water Survey Consultancy

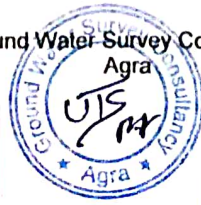

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

