

REPORT ON GEO-PHYSICAL ELECTRICAL
LOGGING OF BOREHOLE

at
Village : Chandanhedhi
Chhapparauli, Baghpat, Uttar Pradesh

For
M/s. LC Infra Projects Private Limited.
Ahmedabad.

Conducted by



GLOBAL GROUND WATER CONSULTANTS
(Consulting Geologists & Geophysicists)
84- III Floor, Humayun pur, Safdarjung Enclave, New Delhi - 110 029
Phone: **9818-888824; 9818-007038.**

Date : 12th June, 2022

REPORT ON GEO-PHYSICAL RESISTIVITY LOGGING OF BOREHOLE

At

Village : Chandanhedhi
Chhaparauli, Baghpat, Uttar Pradesh

Introduction:

A deep borehole 147 (482 Feet) was drilled M/s. LC Infra Projects Limited, Ahmedabad, On the request of M/s. LC Infra Projects Limited, Ahmedabad, GGWC conducted a Geophysical Resistivity logging in the above borehole using IGIS's Logger dated on 12th June, 2022

Based on the interpretation of the Logging, the following litho logy has been inferred which tallies fairly well with the well-site litho-log based on mud-wash samples.

<i>Depth in m</i>	<i>Expected Litholog</i>	<i>Expected Quality</i>
0 - 3	Surface Soil	
3 - 12	Clay	
12 - 24	Sand with kankar	
24 - 33	Sandy clay	
33 - 69*	Medium sand	Good
69 - 73	Sandy clay	
73 - 88*	Medium sand	Good
88 - 93	Sandyclay	
93 - 100*	Medium sand	Good
100 - 113*	Fine sand	Good
113 - 122	Sandy clay	
122 - 147	Clay kankar	

Conclusions and Recommendations:

1. The litholog inferred broadly tallies with that of the well-site litholog.
2. The zones marked with asterisk (*) appear to be Aquifer Zones for possible development of tubewell.
3. As per thickness of the Aquifer the expected discharge is 50,000 LPH to 60,000 LPH.
4. Water Level is 23 m below ground level.
5. The Quality of water is Good. However, it is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
6. The shallow aquifers are also recommended for development to get good quantity of water.
7. *All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.*

for Global Groundwater Consultants



A handwritten signature in blue ink, appearing to be "K. Singh".

Chief Executive

SP and Resistivity Curves

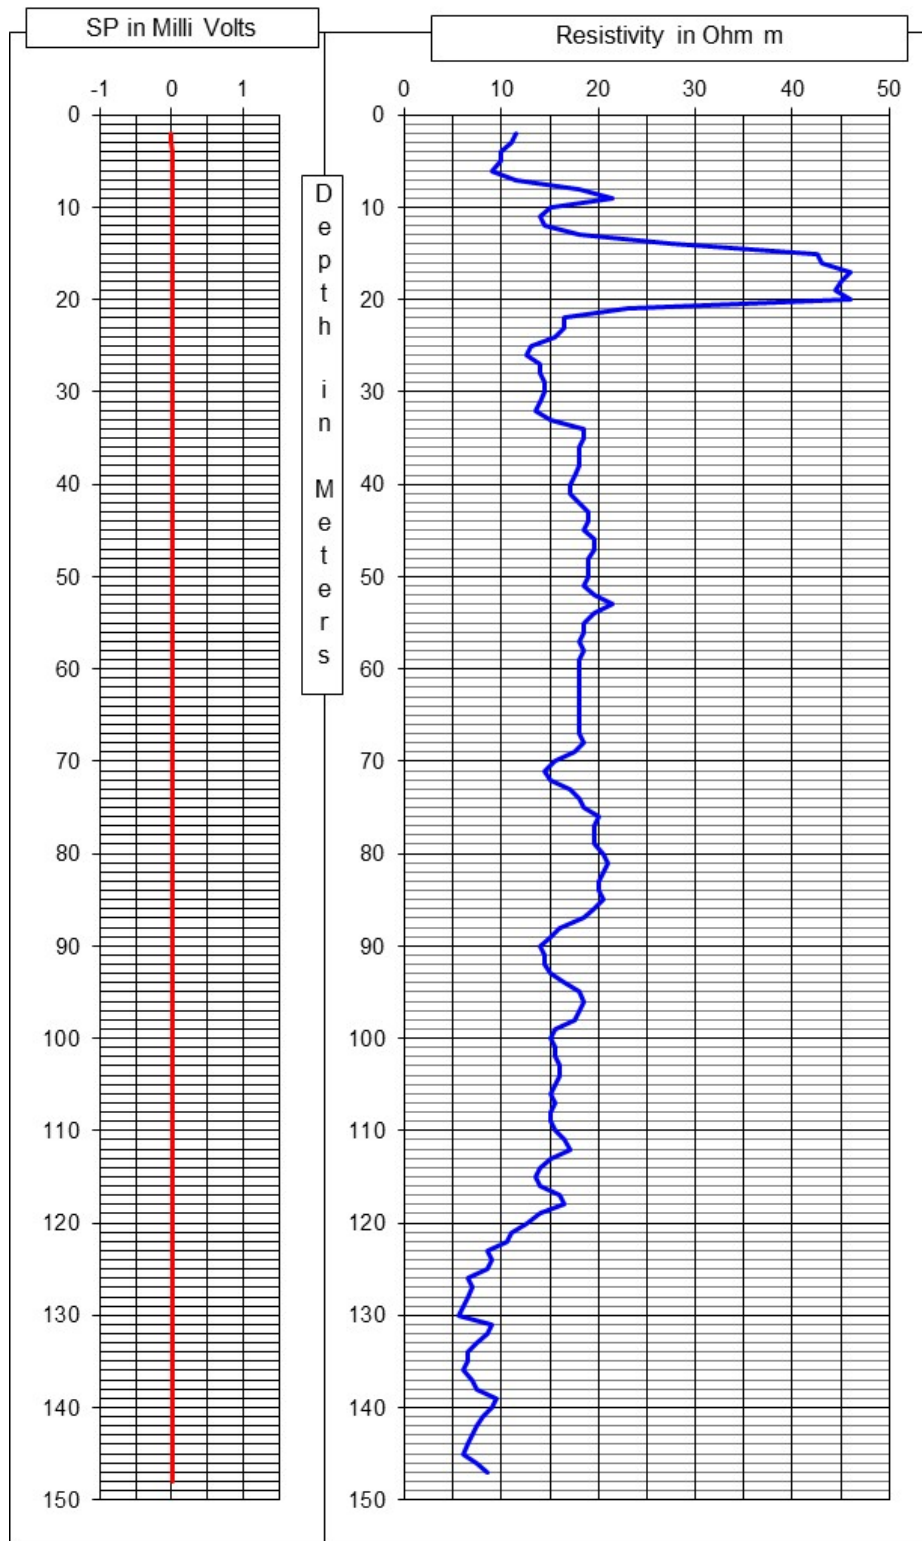




Photo of the Site at the time of Logging