



GLOBAL GROUND WATER CONSULTANTS

84-III Floor, Humayunpur, Safdarjung Enclave, New Delhi - 110 029
 Mobile: 9818 888 824, 9818 007 038
 E-mail: srikanthchukka123@gmail.com, ravikanth44@yahoo.com

GEOPHYSICAL ELECTRICAL LOGGING REPORT AT

Tubewell No: _____


Village: **AUPHAD**

Block: **DIBAI**

District: **BULAND SAHR, U.P**

Date: **23.10.2022**

Depth in Metres	Expected Lithology	Expected Water Quality
0 - 3	Surface soil	
3 - 15	Fine sand	
15 - 20	Fine sand	Good
20 - 25	clay	
25 - 42	medium sand	Good
42 - 43	clay	
43 - 53	Fine sand	Good
53 - 70	medium sand	Good
70 - 80	clay	
80 - 99	medium sand	Good
99 - 101	clay	
101 - 106	Fine sand	Good
106 - 138	clay kankar	
138 - 148	Fine sand	Good
148 - 155	Sandy clay	

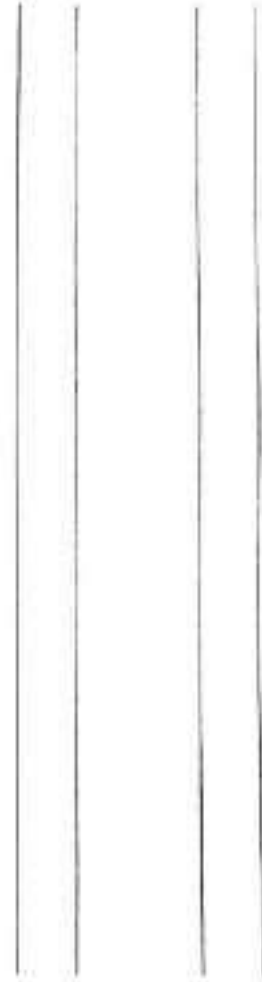

⊗ EXPECTED WATER ZONE

For Global Groundwater Consultants

(Signature)
 M. RAVI KANTH