

GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTROLOGGING REPORT

Ref No:-A- 50

Date:- 03-04-2023

NAME OF SITE

GRAM PANCHAYAT- Mawadiya Marauri BLOCK- Bilsanda DISTT- Pilibhit

NAME OF AGENCY

M/s Vishvaraj Environment Pvt. Ltd.



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy



REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- MAWADIYA MARAURI, BLOCK- BILSANDA, DISTT.- PILIBHIT
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 150 mtrs. depth. and Logged depth 150 mtrs. at above site. Was drilled by M/s Vishvaraj Environment Pvt. Ltd.

On the request of M/s Vishvaraj Environment Pvt. Ltd. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 03.April.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 10	5	Fine sand	
3.	10 - 15	5	Clay kankar	
4.	15 - 28	13	Fine to Medium sand	Medium
5.	28 - 35	7	Clay kankar	
6.	35 - 55*	20	Medium sand	Medium
7.	55 - 60	5	Clay kankar	
8.	60 - 73*	13	Medium sand	Medium
9.	73 - 110	37	Clay kankar	
10.	110 - 130*	20	Medium sand	Medium
11.	130 - 150	20	Clay kankar	


Ground Water Survey Consultancy



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

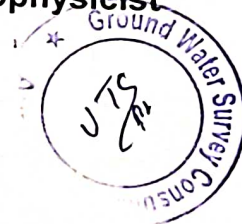

Ground Water Survey Consultancy

Rinc 1
 N16 (SN)
 NS4(LN)
 LAT

Logging of Kharadrya
 masbur blok
 Zolanda dist
 Pracin
 1 Oct 2013
 03 Apr 2013
 13.25
 ulhas sh gupta
 surandi

SP (m V)

