

**GROUND WATER SURVEY CONSULTANCY**  
**GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS**

**GEO-PHYSICAL WELL**  
**ELECTOLOGGING REPORT**

Ref No:-B- 802

Date:- 03-06-2023

**NAME OF SITE**

GRAM PANCHAYAT- Aruaa Khanpur      BLOCK- Kanth      DISTT- Shahjahanpur

**NAME OF AGENCY**


M/s NCC Ltd.  
Shahjahanpur



**GROUND WATER SURVEY CONSULTANCY**  
Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.  
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006  
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy  
Agra

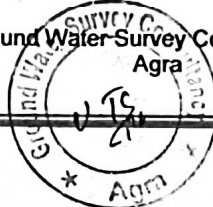

# REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- ARUAA KHANPUR, BLOCK- KANTH,  
DISTT- SHAHJAHANPUR  
UNDER  
JAL JIVAN MISSION


## Introduction :

A Deep bore hole was drilled 120 mtrs. depth. and Logged depth 120 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 05.June.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table


S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 10	5	Dry sand	
3.	10 - 15	5	Clay kankar	
4.	15 - 25	10	Fine sand	
5.	25 - 33	8	Clay kankar	
6.	33 - 41	8	Fine to Medium sand	Good
7.	41 - 45	4	Clay kankar	
8.	45 - 77*	32	Medium sand & kankar	Good
9.	77 - 84	7	Clay kankar	
10.	84 - 93*	9	Medium sand	Good
11.	93 - 105	12	Clay kankar	
12.	105 - 115*	10	Fine to Medium sand	Good
13.	115 - 120	5	Clay kankar	

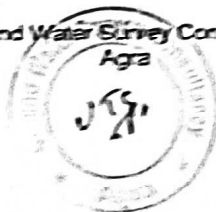

**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geophysicist**

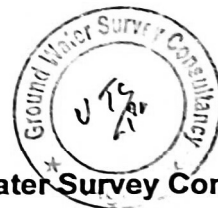

**Ground Water Survey Consultancy**

No. 3  
 NISX  
 NISIN  
 LAT  
 Logging Details:  
 V. K. Jaiswal  
 U.P. State  
 22/04/2022  
 17:55  
 Sheet: Green 502

Log No: 1085/S/M/21-22  
 Log Book: SP (m V)

Log No: DMPL-2  
 Log Book: GROUND WATER SURVEY CONSULTANCY - AGRA INDIA

