

GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTROLOGGING REPORT

Ref No:-A-599

Date:- 22-05-2023

NAME OF SITE

GRAM PANCHAYAT- Rampura Kon BLOCK- Puranpur DISTT- Pilibhit

NAME OF AGENCY

M/s Vishvaraj Environment Pvt. Ltd.



GROUND WATER SURVEY CONSULTANCY


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

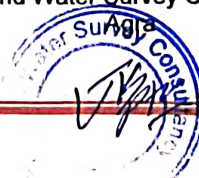

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- RAMPURA KON, BLOCK- PURANPUR,
DISTT.- PILIBHIT
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S Vishvaraj Environment Pvt. Ltd.

On the request of M/S Vishvaraj Environment Pvt. Ltd. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 22.May.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 15	10	Clay kankar	
3.	15 - 25	10	Fine sand	Med to Good
4.	25 - 30	5	Clay kankar	
5.	30 - 45	15	Medium sand	Med to Good
6.	45 - 55	10	Clay kankar	
7.	55 - 67*	12	Medium sand	Med to Good
8.	67 - 81	14	Clay kankar	
9.	81 - 89*	8	Medium sand	Med to Good
10.	89 - 93	4	Clay kankar	
11.	93 - 113*	20	Medium sand	Med to Good
12.	113 - 116	3	Clay kankar	
13.	116 - 125*	9	Medium sand	Med to Good
14.	125 - 130	5	Clay kankar	

Ground Water Survey Consultancy
Agra



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tube well.
3. The Quality of water is expected Medium to Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

Rho a
N 16SN
N 64 LN
LAT

Location:
Logging Via: [unclear]
Bore: [unclear]
Depth:
Log No:
Date:
Time:
Operator:
User: [unclear]
In: [unclear]

Log No: IGSS/01/21-22

Log No: DMAPL-2

GROUND WATER
SURVEY
CONSULTANCY
AGRA, UP, India

