

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL
ELECTOLOGGING REPORT

Ref No:- 1345

Date:- 09-12-2022

NAME OF SITE

Gram Panchayat- Jaitapur Simra

BLOCK- Kant

DISTT- Shahjahanpur

NAME OF AGENCY

M/s NCC Ltd.
Shahjahanpur



GROUND WATER SURVEY CONSULTANCY


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

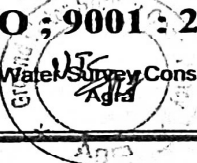

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- JAITAPUR SIMRA, BLOCK- KANT,
DISTT- SHAHJAHANPUR
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 140 mtrs. depth. and Logged depth 135 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 09.Dec.2022.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 18	13	Clay kankar	
3.	18 - 42	24	Medium sand	Med to Good
4.	42 - 46	4	Clay kankar	
5.	46 - 56*	10	Medium sand	Med to Good
6.	56 - 62	6	Clay kankar	
7.	62 - 74*	12	Medium sand	Med to Good
8.	74 - 80	6	Clay kankar	
9.	80 - 98*	18	Medium sand	Med to Good
10.	98 - 105	7	Clay kankar	
11.	105 - 116*	11	Medium sand	Med to Good
12.	116 - 119	3	Kankar	
13.	119 - 123*	4	Medium sand	Med to Good
14.	123 - 135	12	Clay kankar	

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium to Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

Rho a
 N16 (SN)
 N64(LN)
 LAT

GEOTECH CONSULTANTS
 100, BROADWAY
 22ND FLOOR
 NEW YORK, NY 10002
 TEL: 212 693 9300
 FAX: 212 693 9301
 E-MAIL: GCS@GCS.COM

SP (mV)

