



m/s. welspm



**GLOBAL GROUND WATER CONSULTANTS**

84-III Floor, Humayunpur, Safdarjung Enclave, New Delhi - 110 029  
Mobile : 9818 888 824, 9818 007 038  
E-mail : srkanthchukka.c23@gmail.com, ravikanth44@yahoo.com

Mrs. Kusuma  
Mr. Kishan Chopra


**GEOPHYSICAL ELECTRICAL LOGGING REPORT AT**

Tubewell No. : .....

Date : 13.05.2023

Village : DHAKRAULI  
Block : JAHINGHIRABAD  
District : BULAND SAHAR, U.P

Depth in Metres	Expected Litholog	Expected Water Quality
0 - 3m	Surface Soil	
3 - 14	Fine Sand	
14 - 22 <sup>⊗</sup>	Medium Sand	Good
22 - 27	clay	
27 - 81 <sup>⊗</sup>	Medium Sand	Good
81 - 90	Clay	
90 - 108 <sup>⊗</sup>	Medium Sand	Good
108 - 115	clay	
115 - 130 <sup>⊗</sup>	Medium Sand	Good
130 - 140	Sandy clay	
140 - 150	clay with kankar.	

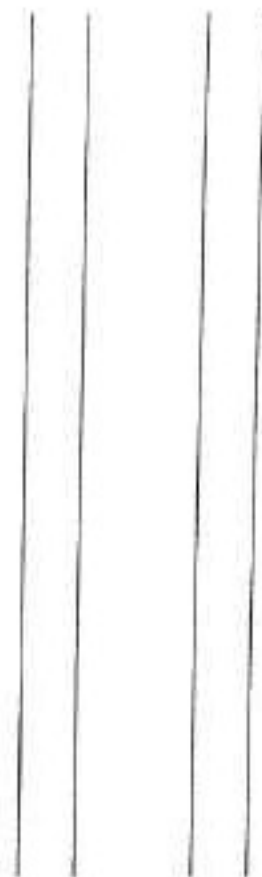

⊗ EXPECTED WATER ZONE  
▼ WATER LEVEL : 14 METRES

For Global Groundwater Consultants  
*M. Ravi Kant*  
M. RAVI KANT  
13/5/2023

Consulting Geologists, Geophysicists & Ground Water Specialists

Scanned by CamScanner