

**GROUND WATER SURVEY CONSULTANCY**  
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL  
ELECTOLOGGING REPORT**

Ref No:-A-1227

Date:- 29-07-2023

**NAME OF SITE**

GRAM PANCHAYAT- Gopalpur Thathuura  
DISTT- Shahjahanpur

BLOCK- Kanth

**NAME OF AGENCY**

M/s NCC Ltd.  
Shahjahanpur



**GROUND WATER SURVEY CONSULTANCY**  
Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.  
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006  
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy



# REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- GOPALPUR THATHUURA, BLOCK- KANTH,  
DISTT- SHAHJAHANPUR  
UNDER  
JAL JIVAN MISSION

## Introduction :


A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 129 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 29.July.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 10	5	Dry sand	
3.	10 - 15	5	Fine to Medium sand	
4.	15 - 30	15	Clay	
5.	30 - 52	22	Fine to Medium sand	Medium
6.	52 - 56	4	Clay kankar	
7.	56 - 63*	7	Medium sand	Medium
8.	63 - 69	6	Clay kankar	
9.	69 - 84*	15	Medium sand	Medium
10.	84 - 94	10	Clay kankar	
11.	94 - 106*	12	Medium sand	Medium
12.	106 - 114	8	Clay kankar	
13.	114 - 120*	6	Medium sand	Medium
14.	120 - 129	9	Sandy clay kankar	


Ground Water Survey Consultancy

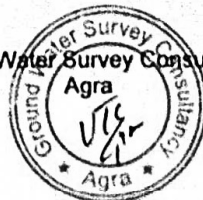

**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geophysicist**

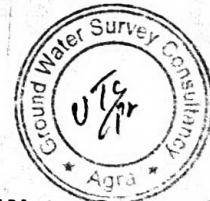

**Ground Water Survey Consultancy**

Sheet No. 1  
 N 1635N  
 N 64 01N  
 LAT

Location: ...  
 Project No.: ...  
 Date: ...  
 Scale: ...  
 Drawing: ...  
 Rev: ...

Log No.: IG/S/02/22-23

SP

DMP-2

Ground Water Survey  
 Consultancy  
 AGRA, UP, INDIA

