

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTOLOGGING REPORT**

Ref No:-A- 590

Date:- 20-05-2023

NAME OF SITE

GRAM PANCHAYAT- Manakpur

BLOCK- Shehad Nagar

DISTT- Rampur

NAME OF AGENCY

M/s PNC-SPML-JV

Moradabad

22, CAMAC STREET, BLOCK-A, 3rd FLOOR, KOLKATA-700016



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.


112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

Agra

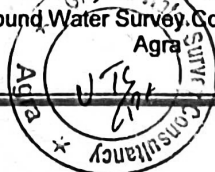

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- MANAKPUR, BLOCK- SHEHAD NAGAR, DISTT- RAMPUR UNDER JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 140 mtrs. depth. and Logged depth 140 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Moradabad.

On the request of M/S PNC-SPML-JV, Moradabad. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 20.May.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 17	12	Fine sand	
3.	17 - 20	3	Clay	
4.	20 - 36	16	Fine to Medium sand	Medium
5.	36 - 41	5	Clay kankar	
6.	41 - 46	5	Medium sand	Medium
7.	46 - 59	13	Clay kankar	
8.	59 - 100*	41	Medium sand & kankar	Medium
9.	100 - 105	5	Clay kankar	
10.	105 - 124*	19	Medium sand	Medium
11.	124 - 130	6	Clay kankar	
12.	130 - 135	5	Fine sand	Medium
13.	135 - 140	5	Clay	

Ground Water Survey Consultancy



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

Rho a
 N16(SN)
 N64(LN)
 LAT
 Logging Details:
 V: Ura Gur, Block, Sahas
 Nagar, Dist. Rampur
 UP, INDIA
 20 May 2023
 15:04
 Ura Gur, Sahas Nagar

Logger Site:
 IGIS/S/02/22-23

logger Model:
 DMPL-2
 Logger Owned by:
 GROUND WATER
 SURVEY
 CONSULTANCY
 AGRA, UP, INDIA

