GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL **ELECTOLOGGING REPORT**

HALLINAN MINHON

Ref No:-B- 570

Introduction!

Date: - 22-05-2023

NAME OF SITE

Lorong Pais rayabe - Bell potential, short referral/abillar, burg Norand (1984), burg is

On the riso set of Mrs 3000 Atd., Shatijahanpur, a Gassot valosi wei Logging

of Sacia Clarifornia of him in the capitons are the original factors.

A Cose work rule sets ablight the over the Poland Cose of depth to the

GRAM PANCHAYAT- Majra Badhau BLOCK- Mirzapur

DISTT- Shahjahanpur

NAME OF AGENCY

M/s NCC Ltd. Shahjahanpur



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations. 112 A-Shree Nagar Colony, Firozabad Road, Agra-282006 (M): 9412260823, 9794625420, 9761163000, Email: gwsc agra@yahoo.com

> ISO: 9001: 2015 Ground Water Survey Consultancy

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- MAJRA BADHAU, BLOCK- MIRZAPUR, DISTT- SHAHJAHANPUR UNDER JAL JIVAN MISSION

Introduction:

A Deep bore hole was drilled 125 mtrs. depth. and Logged depth 124 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 22.May.2023.


roser a compare do primitar interestantidas.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral.

Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table

use or moved and being and of he was fore as the undersamine exists one

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
) 1,	0 - 5	5	Surface soil	
2.	5 - 14	9	Fine sand	
3.	14 - 20	6	Clay kankar	4.
4,	20 - 31	11	Fine to Medium sand	Good
5.	31 - 55	24	Clay kankar	
6.	55 - 75*	20	Medium sand	Good
7.	75 - 101	26	Clay kankar	1
8.	101 - 125*	24	Fine to Medium sand	Good
9.	125 - 126	1	Clay kankar	

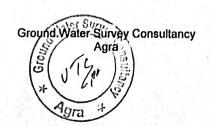

Conclusions and Recommendations :-

- 1. The Lithology broadly tallies with that of drill cutting strata chart.
- 2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
- 3. The Quality of water is expected Good.
- 4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
- 5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

Ground Water Survey Consultancy

