

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL
ELECTROLOGGING REPORT

Ref No:- A-103

Date:- 04-02-2023

NAME OF SITE

Gram Panchayat- Nausana Paharipur

BLOCK- Khudaganj Katra

DISTT- Shahjahanpur

NAME OF AGENCY

M/s NCC Ltd.
Shahjahanpur



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy



REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- NAUSANA PAHARIPUR, BLOCK- KHUGANJ KATRA,
DISTT- SHAHJAHANPUR
UNDER
JAL JIVAN MISSION

Introduction :


A Deep bore hole was drilled 120 mtrs. depth. and Logged depth 120 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 04.Feb.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-


S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 16	11	Clay kankar	
3.	16 - 20	4	Fine sand	
4.	20 - 27	7	Fine to Medium sand	Good
5.	27 - 33	6	Clay kankar	
6.	33 - 39	6	Medium sand	Good
7.	39 - 42	3	Clay kankar	
8.	42 - 58*	16	Medium sand	Good
9.	58 - 62	4	Clay kankar	
10.	62 - 66*	4	Fine to Medium sand	Good
11.	66 - 68	2	Clay kankar	
12.	68 - 76*	8	Medium sand & kankar	Good
13.	76 - 82	6	Kankar	
14.	82 - 98*	16	Medium sand	Good
15.	98 - 106	8	Clay kankar	
16.	106 - 110*	4	Fine to Medium sand	Good
17.	110 - 120	10	Clay kankar	

Ground Water Survey Consultant

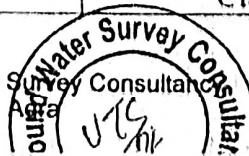

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

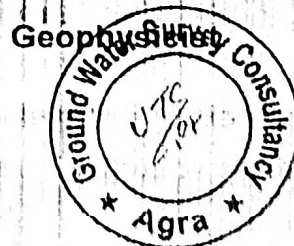

Ground Water Survey Consultancy

Rho a
 NI6 (SN)
 N64(LN)
 LAT

Logging W Nausana
 paharpur vikraypur
 block khudhaganj
 distt sahaajapur
 LOGGINGDOWN
 04 Feb 2023
 20:57
 utkarsh gupta
 (arvindi)

SP (m V)

