

**GROUND WATER SURVEY CONSULTANCY**  
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL  
ELECTOLOGGING REPORT**

Ref No:-A- 485

Date:- 20-03-2023

**NAME OF SITE**

Gram Panchayat- Radhaupur Sikandarpur & Areli Ismailpur  
DISTT- Shahjahanpur

BLOCK- Nigohi

**NAME OF AGENCY**

M/s NCC Ltd.  
Shahjahanpur



**GROUND WATER SURVEY CONSULTANCY**


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy

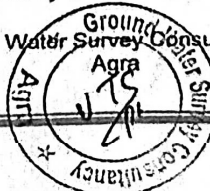

# REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- RADHAUPUR SIKANDARPUR & ARELI ISMAILPUR,  
BLOCK- NIGOHI, DISTT- SHAHJAHANPUR  
UNDER  
JAL JIVAN MISSION

## Introduction :


A Deep bore hole was drilled 131 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 20.Mar.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 11	6	Dry sand	
3.	11 - 20	9	Clay kankar	
4.	20 - 36	16	Fine to Medium sand	Good
5.	36 - 44	8	Clay kankar	
6.	44 - 50	6	Fine to Medium sand	Good
7.	50 - 55	5	Clay kankar	
8.	55 - 62*	7	Medium sand	Good
9.	62 - 66	4	Clay kankar	
10.	66 - 76*	10	Medium sand	Good
11.	76 - 83	7	Clay kankar	
12.	83 - 106*	23	Medium sand	Good
13.	106 - 114	8	Clay kankar	
14.	114 - 125*	11	Medium sand	Good
15.	125 - 130	5	Clay kankar	

Ground Water Survey Consultancy



**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geophysicist**



**Ground Water Survey Consultancy**

Rho a  
 1116(SM)  
 NS4(LM)  
 LAT

Company of Engineers  
 Surveyors & Architects  
 107, Park Road, Sector 14, Gurgaon  
 Haryana, India  
 122001  
 URBAN-GURGAON, Haryana

SP (mV)

