GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTOLOGGING REPORT

TELLINA PARTILIANA

Ref No:-A- 945

Date: - 29-06-2023

NAME OF SITE

Details of the or we day hondaline unblock from his pay of large hos combined with the court

a Especializares de la secula confisió 120 mbra, dendiciare de Companio especial de la companio especial de la

GRAM PANCHAYAT- Nawada Rudrapur BLOCK- Kanth DISTT- Shahjahanpur

NAME OF AGENCY

M/s NCC Ltd. Shahjahanpur



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations. 112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006 (M): 9412260823, 9794625420, 9761163000, Email: gwsc agra@yahoo.com

ISO; 9001: 2015

Ground Water Survey Consultancy

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- NAWADA RUDRAPUR, BLOCK- KANTH, DISTT- SHAHJAHANPUR UNDER JAL JIVAN MISSION

the most ratio of a great to be applied to see for passing

Introduction:

A Deep bore hole was drilled 120 mtrs. depth. and Logged depth 120 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 29.June.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

electional and made pools he variations as the underground

S.No.	Depth range(m)	Thickness(m	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 17	12	Clay	
3.	17 - 25	8	Fine sand	
4.	25 - 30	5	Clay kankar	
5.	30 - 37	7	Medium sand	Medium
6.	37 - 44	7	Clay kankar	
7.	44 - 48*	4	Medium sand	Medium
8.	48 - 53	5	Clay kankar	SIL
9.	53 - 60*	7	Medium sand	Medium
10,	60 - 66	6	Clay kankar	the second
11.	66 - 79*	13	Medium sand	Medium
12.	79 - 86	7	Clay kankar	
13.	86 - 96*	10	Medium sand	Medium
14.	96 - 100	4	Clay kankar	The state of the s
15.	100 - 103*	3	Medium sand	Medium
16.	103 - 120	17	Clay kankar	


Ground Water Survey Consultancy

Conclusions and Recommendations :-

- 1. The Lithology broadly tallies with that of drill cutting strata chart.
- 2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
- 3. The Quality of water is expected Medium.
- 4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
- All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

Ground Water Survey Consultancy

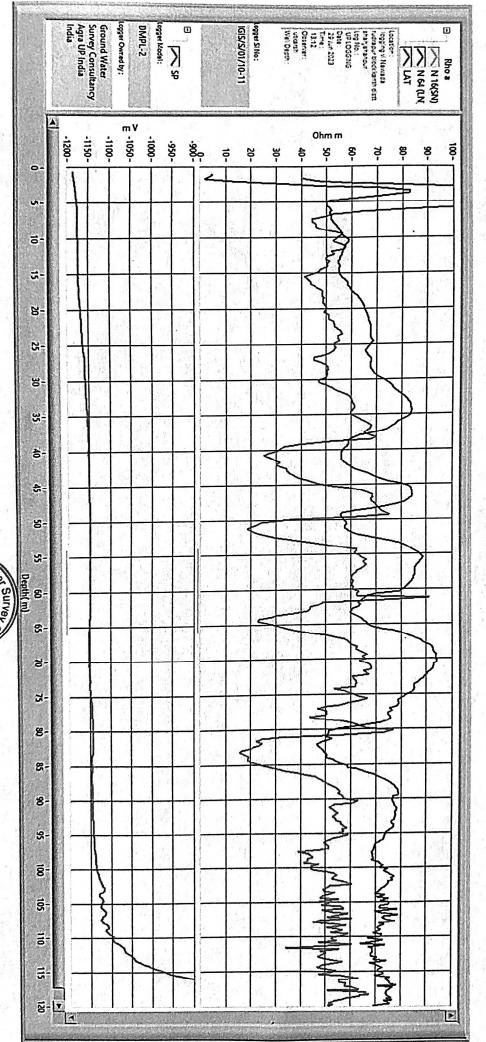

Ground War