GROUND WATER SURVEY CONSULTANCY

CONTRACTOR AND ADMINISTRAL CONTRACTOR AND ADMINISTRATION AND ADMINISTRATIONA

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTOLOGGING REPORT

Ref No:- A-243

Date: 18-02-2023

NAME OF SITE

Gram Panchayat- Hawaspur

BLOCK-Tilhar

DISTT- Shahjahanpur

NAME OF AGENCY

M/s NCC Ltd. Shahjahanpur



GEOUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M): 9412260823, 9794625420, 9761163000, Email: gwsc agra@yahoo.com

e! \$ 100 \cdot 2015

Growing Water Survey Consultancy

REPORT ON GEOPHYSICAL WELL LOGGING

GRAM PANCHAYAT- HAWASPUR, BLOCK- TILHAR, DISTT- SHAHJAHANPUR
UNDER
JAL JIVAN MISSION


Introduction:

A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 18.Feb.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 12	7	Clay kankar	
3.	12 - 23	11	Fine sand	
4.	23 - 28	5	Kankar	
5.	28 - 30	2	Clay kankar	
6.	30 - 42	12	Fine to Medium sand	Good
7.	42 - 50	8	Clay kankar	
8.	50 - 66*	16	Medium sand & kankar	Good
9.	66 - 72	6	Clay kankar	
10.	72 - 97*	25	Medium sand & kankar	Good
11.	97 - 104	7	Clay kankar	
12.	104 - 112*	8	Fine to Medium sand	Good
13.	112 - 118	6	Clay kankar	
14.	118 - 120	2	Fine sand	Good
15.	120 - 130	10	Clay kankar	

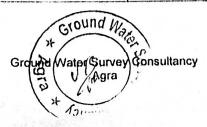

Conclusions and Recommendations :-

- 1. The Lithology broadly tallies with that of drill cutting strata chart.
- 2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
- The Quality of water is expected Good.
- 4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
- 5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

Ground Water Survey Consultancy

Go-Hawarauri ecc-Tibar DireSanquingur UP-OGG/NGUn 18 Fen 2023 17 16 Gauray Rho a N16 (SN; LAT SP (m V) Ohm m 8 8 A 8 5 5 50 120-140--07 ş 20 - 20 -9-40 ş u**ä**-5-8-않-ප-ห--8 **:** Š. 5-8-୫-겅-겅-8-3 않-ଞ୍ଚ-**%**-ទី-죠-ਵ-ᇙ-쥖-더-평-17

