

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTROLOGGING REPORT**

Ref No:-B- 3114

Date:- 25-02-2023

NAME OF SITE

GRAM PANCHAYAT- Kuan Kheda Bhogpur BLOCK- Bilashpur DISTT- Rampur

NAME OF AGENCY


M/s PNC-SPML-JV
Rampur
22, CAMAC STREAT, BLOCK-A, 3rd FLOOR, KOLKATA-700016



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015
Ground Water Survey Consultancy

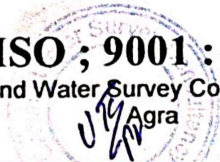

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- KUAN KHEDA BHOGPUR, BLOCK- BILASHPUR, DISTT- RAMPUR
UNDER
JAL JIVAN MISSION

Introduction :


A Deep bore hole was drilled 110 mtrs. depth. and Logged depth 110 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Rampur.

On the request of M/S PNC-SPML-JV, Rampur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 20.Feb.2024.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 8	3	Fine sand	
3.	8 - 21	13	Clay kankar	
4.	21 - 25	4	Fine sand	Medium
5.	25 - 32	7	Clay kankar	
6.	32 - 40	8	Fine to Med . Sand	Medium
7.	40 - 46	6	Clay kankar	
8.	46 - 49	3	Fine sand	Medium
9.	49 - 63	14	Clay kankar	
10.	63 - 68*	5	Medium sand	Medium
11.	68 - 72	4	Clay kankar	
12.	72 - 75*	3	Medium sand	Medium
13.	75 - 95	20	Clay kankar	
14.	95 - 103*	8	Medium sand	Medium
15.	103 - 108	5	Clay kankar	
16.	108 - 110*	2	Fine To Medium sand	Medium

Ground Water Survey Consultancy

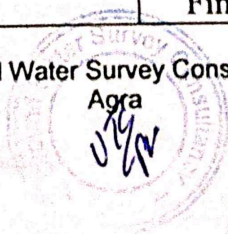

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

LOG SHEET
DATE: 22/04/2011
TIME: 11:30

LOGGING DETAILS
LOGGING IN: WATER LEVEL
LOGGING FROM: SURFACE
DATE: 22/04/2011
TIME: 11:30
LOGGING PERSONNEL:

LOG SHEET NO: 11

SP (mV)

DATE: 2

LOGGED BY: [Signature]
SUPERVISOR: [Signature]
GROUND WATER SURVEY CONSULTANCY
AGRA UP INDIA
INDIA

