GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTOLOGGING REPORT

Ref No:- 643

Date:- 19-08-2022

NAME OF SITE

GRAM PANCHAYAT- Thariya Vishnu

BLOCK- Milak

DISTT- Rampur

NAME OF AGENCY

M/s PNC-SPML-JV Moradabad 22, CAMAC STREAT, BLOCK-A, 3rd FLOOR, KOLKATA-700016



GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations. 112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006 (M): 9412260823, 9794625420, 9761163000, Email: gwsc_agra@yahoo.com

ISO; 9001: 2015

Ground Water

REPORT ON GEOPHYSICAL WELL LOGGING

GRAM PANCHAYAT- THARIYA VISHNU, BLOCK- MILAK, DISTT- RAMPUR UNDER JAL JIVAN MISSION

Introduction:

A Deep bore hole was drilled 113 mtrs. depth. and Logged depth 110 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Moradabad.

On the request of Mr. Pankaj Sinha, Sr. Projects Managar. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 19.August.2022.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major equifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Defth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 35	30	Fine to Medium sand	Good
3.	35 - 45	10	Sandy clay	
4	45 - 60*	15	Fine to Medium sand	Good
5	60 - 69	9	Clay	
6.	69 - 73*	4	Fine to Medium sand	Good
7	73 - 80	7	Clay kankar	
8	80 - 90*	10	Fine to Medium sand	Good
9	90 - 97	7	Clay kankar	Toplant or the
10.	97 - 103*	6	Fine to Medium sand	Good
11	103 - 110	7	Clay kankar	





Conclusions and Recommendations :-

- 1. The Lithology broadly tallies with that of drill cutting starta chart.
- The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
- 3. The Quality of water is expected Good.
- 4. Expected discharge is 800 to 900 L.P.M.
- It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
- All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Ground Water Survey Consultancy

Geophysicist

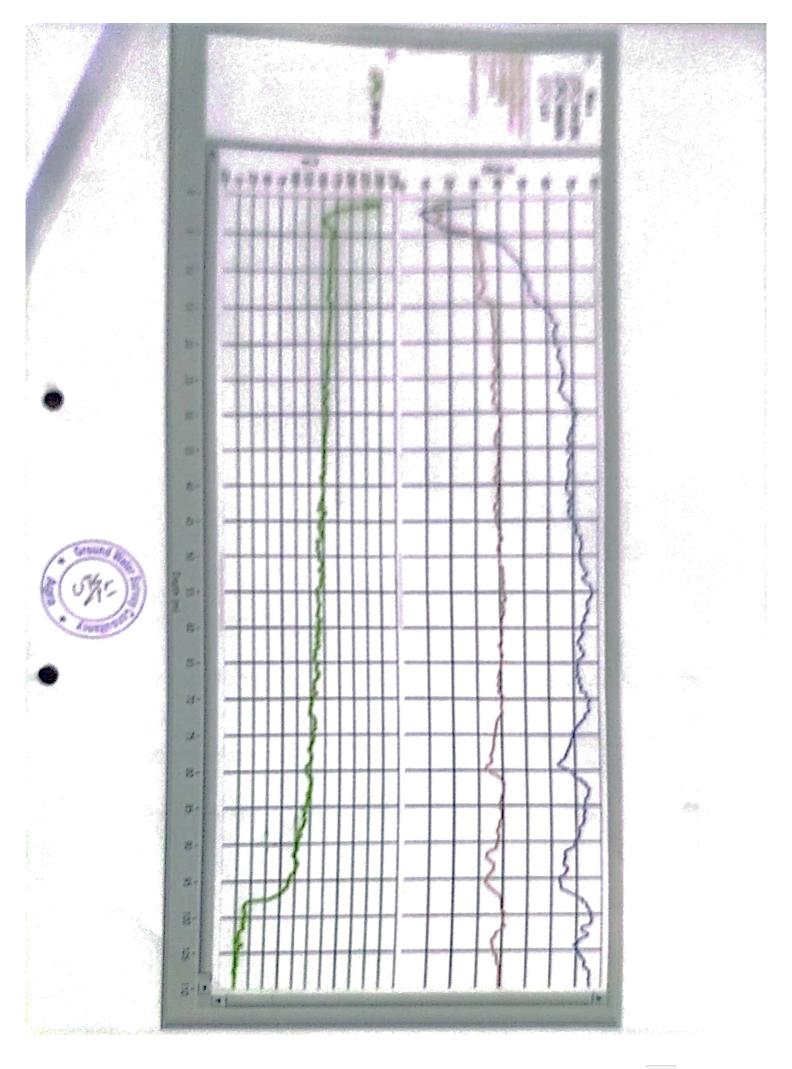

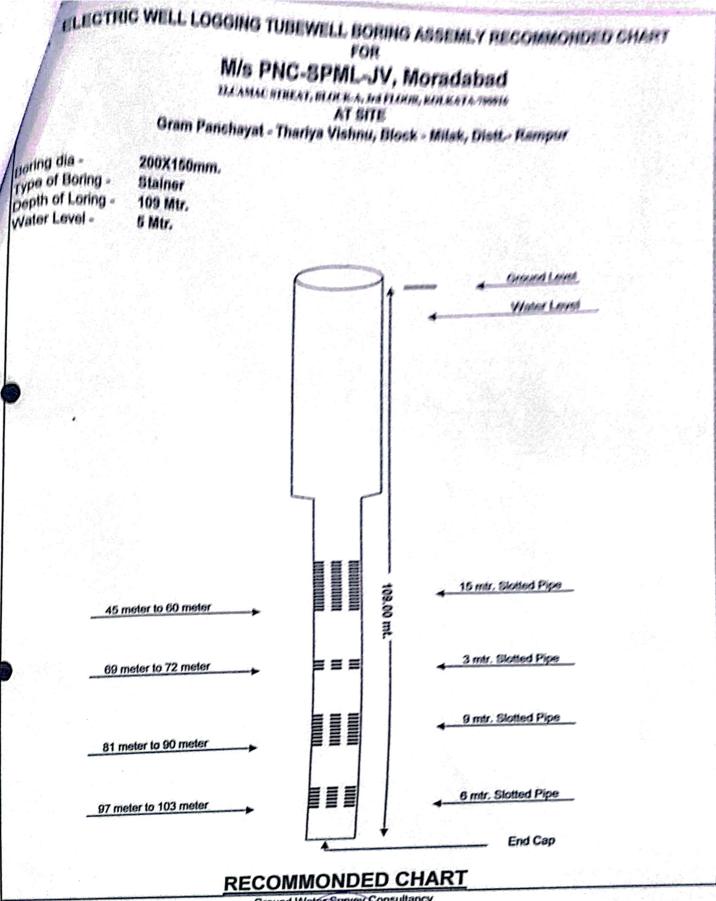

Ground Water Survey Consultancy
Agra

Agra

Agra