

**GROUND WATER SURVEY CONSULTANCY**  
**GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS**

**GEO-PHYSICAL WELL**  
**ELECTROLOGGING REPORT**

Ref No:-A-2485

Date:-04-01-2024

**NAME OF SITE**

GRAM PANCHAYAT- Gadia Hardoi Patti      BLOCK- Usawan      DISTT- Badaun

**NAME OF AGENCY**

M/s PNC-SPML-JV  
Badaun



**GROUND WATER SURVEY CONSULTANCY**


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy

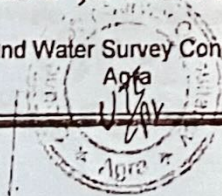

# REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- GADIA HARDOI PATTI, BLOCK- USAWAN, DISTT- BADAUN  
UNDER  
JAL JIVAN MISSION

## Introduction :


A Deep bore hole was drilled 140 mtrs. depth. and Logged depth 140 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 04.Jan.2024.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 17	12	Clay kankar	
3.	17 - 27	10	Medium sand	Medium
4.	27 - 31	4	Clay kankar	
5.	31 - 35	4	Medium sand	Medium
6.	35 - 43	8	Clay kankar	
7.	43 - 46	3	Fine sand	Medium
8.	46 - 50	4	Clay kankar	
9.	50 - 57*	7	Medium sand	Medium
10.	57 - 61	4	Clay kankar	
11.	61 - 72*	11	Medium sand	Medium
12.	72 - 85	13	Clay kankar	
13.	85 - 87*	2	Medium sand	Medium
14.	87 - 103	16	Clay kankar	
15.	103 - 113*	10	Medium sand	Medium
16.	113 - 121	8	Clay kankar	
17.	121 - 130*	9	Medium sand	Medium
18.	130 - 140	10	Clay kankar	

Ground Water Survey Consultancy

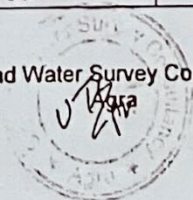

## Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geologist

JTG  
GPI

GROUND WATER  
SURVEY  
CONSULTANCY  
AGRA INDIA

SP No. 2

SP No. 2

SP No. 2

SP No. 2

ISS/04/21-22

Page 5 No

Project Name  
Location  
Date  
Scale  
Drawing No.

Rho  $\rho$   
N 163.5N  
N 64.0N  
LAT

