

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTOLOGGING REPORT**

Ref No:-A-1432

Date:- 18-08-2023

NAME OF SITE

GRAM PANCHAYAT- Kadeka

BLOCK- Dataganj

DISTT- Badaun

NAME OF AGENCY

M/s PNC-SPML-JV
Badaun



GROUND WATER SURVEY CONSULTANCY


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy

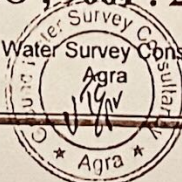

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- KADEKA, BLOCK- DATAGANJ, DISTT- BADAUN
UNDER
JAL JIVAN MISSION

Introduction :

A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 130 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 18.Aug.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 8	3	Clay kankar	
3.	8 - 17	9	Fine to Medium sand	
4.	17 - 23	6	Clay kankar	
5.	23 - 35	12	Medium sand	Medium
6.	35 - 40	5	Clay kankar	
7.	40 - 60*	20	Medium sand & kankar	Medium
8.	60 - 65	5	Clay kankar	
9.	65 - 75*	10	Medium sand	Medium
10.	75 - 81	6	Clay kankar	
11.	81 - 91*	10	Medium sand	Medium
12.	91 - 97	6	Clay kankar	
13.	97 - 102*	5	Fine to Medium sand	Medium
14.	102 - 106	4	Clay kankar	
15.	106 - 117*	11	Medium sand	Medium
16.	117 - 120	3	Clay kankar	
17.	120 - 126*	6	Medium sand	Medium
18.	126 - 130	4	Clay kankar	

Ground Water Survey Consultancy



Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting starta chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tube well.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist



Ground Water Survey Consultancy

Rho a

NI6 (SN)

NS4(L/N)

LAT

Logging Details:

1997 02 22 09:00
Nagar Singh
Dharam Singh
UP, INDIA
18 Aug 2003
11:11
Unit: Sec 42

Logger SI No:

IGIS/S/02/22-23

SP (m V)

Logger Model:

DMPL-2

Logger Owned by:

GROUND WATER
SURVEY
CONSULTANCY
AGRA, UP, INDIA

