

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTROLOGGING REPORT**

Ref No:-A-2037

Date:- 29-10-2023

NAME OF SITE

GRAM PANCHAYAT- Padauliya & Salarpur BOCK- Salarpur DISTT- Badaun

NAME OF AGENCY


M/s PNC-SPML-JV
Badaun



GROUND WATER SURVEY CONSULTANCY
Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO : 9001 : 2015

Ground Water Survey Consultancy

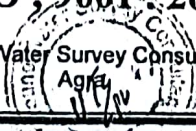

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- PADAULIYA & SALARPUR, BLOCK- SALARPUR,
DISTT- BADAUN
UNDER
JAL JIVAN MISSION

Introduction :


A Deep bore hole was drilled 145 mtrs. depth. and Logged depth 140 mtrs. at above site. Was drilled by M/S PNC-SPML-JV, Badaun.

On the request of M/S PNC-SPML-JV, Badaun. a Geophysical well Logging is conduct at above bore hole using IGIS Well Logger on 29.Oct.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 21	16	Dry sand	
3.	21 - 24	3	Fine sand	
4.	24 - 26	2	Clay kankar	
5.	26 - 50	24	Fine sand	Medium
6.	50 - 59*	9	Medium sand	Medium
7.	59 - 66	7	Clay kankar	
8.	66 - 85*	19	Fine to Medium sand	Medium
9.	85 - 91	6	Clay kankar	
10.	91 - 98*	7	Medium sand	Medium
11.	98 - 115	17	Clay kankar	
12.	115 - 134*	19	Medium sand	Medium
13.	134 - 140	6	Clay kankar	


Ground Water Survey Consultancy

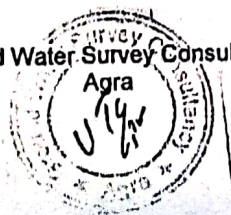

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Medium.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

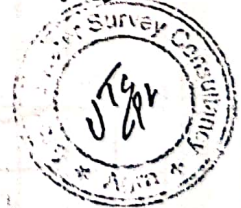

Ground Water Survey Consultancy

B Rho a
 N16 (SN)
 N16 (LN)
 LAT
 Logging Details
 Logging Date: 20/01/2022
 Site No: 16/01/2022
 Job No: 16/01/2022
 Client: UTM
 Location: UTM
 Logged By: UTM

