

# GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

## GEO-PHYSICAL WELL ELECTOLOGGING REPORT

Ref No:-B- 538

Date:- 19-05-2023

### NAME OF SITE

GRAM PANCHAYAT- Churguti      BLOCK- Jalalabad      DISTT- Shahjahanpur

### NAME OF AGENCY

M/s NCC Ltd.  
Shahjahanpur



## GROUND WATER SURVEY CONSULTANCY


Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.

112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006

(M) : 9412260823, 9794625420, 9761163000, Email : gwsc\_agra@yahoo.com

**ISO ; 9001 : 2015**

Ground Water Survey Consultancy  
Agra

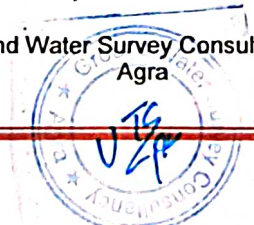

# REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- CHURGUTI, BLOCK- JALALABAD,  
DISTT- SHAHJAHANPUR  
UNDER  
JAL JIVAN MISSION

## Introduction :

A Deep bore hole was drilled 120 mtrs. depth. and Logged depth 120 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahjahanpur.

On the request of M/S NCC Ltd., Shahjahanpur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 19.May.2023.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 10	5	Dry sand	
3.	10 - 13	3	Clay kankar	
4.	13 - 16	3	Fine sand	
5.	16 - 24	8	Clay kankar	
6.	24 - 35	11	Fine to Medium sand	Good
7.	35 - 40	5	Clay kankar	
8.	40 - 65*	25	Medium sand	Good
9.	65 - 75	10	Clay kankar	
10.	75 - 80	5	Fine sand	Good
11.	80 - 85	5	Clay kankar	
12.	85 - 115*	30	Medium sand & kankar	Good
13.	115 - 120	5	Clay kankar	


Ground Water Survey Consultancy



**Conclusions and Recommendations :-**

1. The Lithology broadly tallies with that of drill cutting strata chart.
2. The zones marked with asterisk (\*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Good.
4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
5. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

**Geophysicist**

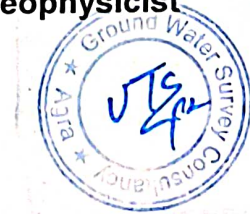

**Ground Water Survey Consultancy**



Rho 1  
 NI 6 (SN)  
 NS4 (UN)  
 LAT  
 Logging Details  
 V - Vertical Log  
 C - Core Log  
 S - Spill Log  
 15 May 2013  
 21:25  
 Unconformity (A/B)  
 Logpin 5 No: IGS/S/02/22-23  
 Logpin Model: DMP-L-2  
 Logpin Owned by: GROUND WATER SURVEY CONSULTANCY AGRA, UP, INDIA

