

GROUND WATER SURVEY CONSULTANCY
GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

**GEO-PHYSICAL WELL
ELECTOLOGGING REPORT**

Ref No:- 672

Date:- 27-03-2022

NAME OF SITE

GRAM PANCHAYAT- Khiria Pathak BLOCK- Sindhauli DISTT- Shahjanhapur

NAME OF AGENCY

M/s NCC Ltd.
Shahjanhapur



GROUND WATER SURVEY CONSULTANCY
Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations.
112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006
(M) : 9412260823, 9794625420, 9761163000, Email : gwsc_agra@yahoo.com

ISO ; 9001 : 2015

Ground Water Survey Consultancy



REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- KHIRIA PATHAK, BLOCK- SINDHAULI
DISTT- SHAHJANHAPUR
UNDER
JAL JIVAN MISSION

Introduction :


A Deep bore hole was drilled 130 mtrs. depth. and Logged depth 129 mtrs. at above site. Was drilled by M/S NCC Ltd., Shahajanhapur.

On the request of M/S NCC Ltd., Shahajanhapur. a Geophysical well Logging in the above bore hole using IGIS Well Logger on 27.Mar.2022.

Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major equifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-


S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 15	10	Clay kankar	
3.	15 - 22	7	Kankar & Sand	
4.	22 - 28	6	Clay kankar	
5.	28 - 37	9	Medium sand	Good
6.	37 - 47	10	Clay kankar	
7.	47 - 66*	19	Medium sand	Good
8.	66 - 70	4	Clay kankar	
9.	70 - 77*	7	Fine to Medium sand	Good
10.	77 - 83	6	Clay kankar	
11.	83 - 110*	27	Medium sand	Good
12.	110 - 122	12	Clay kankar	
13.	122 - 129	7	Medium sand	Good

Ground Water Survey Consultancy

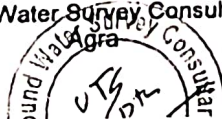

Conclusions and Recommendations :-

1. The Lithology broadly tallies with that of drill cutting starta chart.
2. The zones marked with asterisk (*) appear to be aquifer zones for possible development of tubewell.
3. The Quality of water is expected Good.
4. Expected discharge is 1000 to 1100 L.P.M.
5. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
6. All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

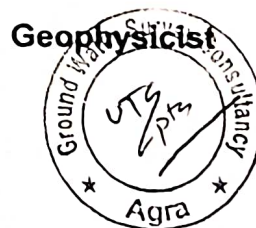

Ground Water Survey Consultancy

Rho a
 N16 (SN)
 N64 (LN)
 LAT

Logging GP Unitria
 Pathal Block
 Simdhanu Distt
 Shahjahanpur
 IOGDIR/SUP
 27.11.2022
 15.11
 Uti arsh Gupta (L-G)

SP (mV)

