GROUND WATER SURVEY CONSULTANCY

GEOLOGISTS, GEOPHYSICISTS & TUBEWELL ENGINEERS

GEO-PHYSICAL WELL ELECTOLOGGING REPORT

Ref No:- B- 2229

Date: - 27-10-2023

NAME OF SITE

GRAM PANCHAYAT- Sorei

BLOCK- Khandauli

DISTT- Agra

NAME OF AGENCY

M/s Shishupal Singh Parihar Agra




GROUND WATER SURVEY CONSULTANCY

Electric Well Logging, Geophysical Resistivity Survey, Ground Water Investigations. 112 A-Shree Nagar Colony, Firozabad Road, Agra- 282006 (M): 9412260823, 9794625420, 9761163000, Email: gwsc_agra@yahoo.com

ISO; 9001: 2015

Ground Water Survey Consultancy

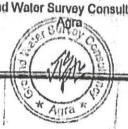

REPORT ON GEOPHYSICAL WELL LOGGING AT

GRAM PANCHAYAT- SOREI, BLOCK- KHANDAULI, DISTT- AGRA

Introduction:

A Deep bore hole was drilled 110 mtrs. depth. and Logged depth 96 mtrs. at above site. Was drilled by M/s SHISHUPAL SINGH PARIHAR AGRA

On the request of M/s. SHISHUPAL SINGH PARIHAR AGRA a Geophysical well Logging in the above bore hole using IGIS Well Logger on 27.Oct .2023.



Logging Para meters - Self potential, short normal (N-16), Long Normal (N-64), Lateral. Details of major Aquifer formations explored from logging of bore hole combined with the study of Strata Chart prepared from drill cuttings are given in the following table:-

Mud Resistivity = 10.67 Ohms.

Drilling Water Resistivity = 11.83 Ohms.

Approx Water Level = 31 Mtr.

S.No.	Depth range(m)	Thickness(m)	Lithology	Expected Water Quality
1.	0 - 5	5	Surface soil	
2.	5 - 31	26	Dry sand	
3.	31 - 40	9	Clay kankar	
4.	40 - 43	3	Fine sand	
5.	43 - 48	5	Clay kankar	
6.	48 - 64*	16	Fine to Medium sand	Med to Marginally
7.	64 - 70	6	Clay kankar	
8.	70 - 77*	7	Fine to Medium sand	Med to Marginally
9.	77 - 85	8	Clay kankar	
10.	85 - 93	8	Fine to Medium sand	Marginally saline
11.	93 - 103	10	Clay kankar	




Conclusions and Recommendations :-

- The Lithology broadly tallies with that of drill cutting strata chart.
- The zones marked with asterisk (*) appear to be aquifer zones for possible Development of tube well.
- 3. The Quality of water is expected Medium to Marginally saline.
- 4. It is recommended to have a chemical and bacteriological analysis of the water sample before using it for human consumption or for any other use.
 - All projections and recommendations are subject to the inherent limitations of the technique employed and there could be variations as the underground conditions are not always amenable to physical interpretations.

Geophysicist

Ground Water Survey Consultancy

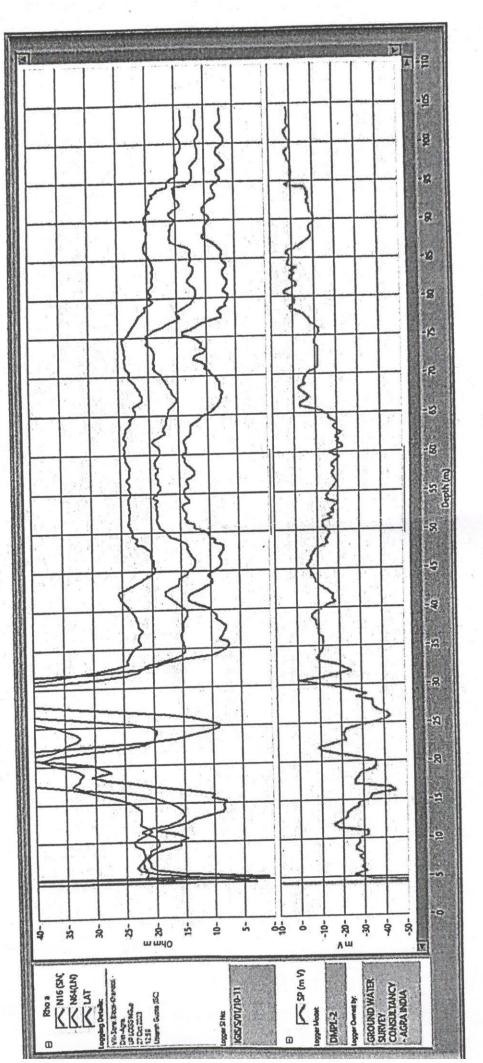



Office of Executive Engineer, Division office (E&M), U.P Jal Nigam (Rural), Agra

ACTUAL TUBEWELL ASSEMBLY

Name of Scheme:

Sorai Rebore TW No. 1

Block: Khandauli

Tehsil: Etmadpur

District:

Agra

C.B. No. 01/SE/2023-24

Name of Contractor: M/s Shishupal Singh Parihar

Logging Date:

27.10.2023

Drilling Completion Date:

26.10.2023

Logging By:

Ground Water Survey Consultancy

Size of Assembly:

200x200 mm

Static Water Level: 45.00 m

1. Strata as per Drilling/Logging:-

0-5 mtr	Surface soil
5-31 mtr	Dry sand
31-40 mtr	Clay Kankar
40-43 mtr	Fine sand
43-48 mtr	Clay Kankar
48-64 mtr	Fine to medium sand
64-70 mtr	Clay Kankar
70-77 mtr	Fine to medium sand
77-85 mtr	Clay Kankar
85-93 mtr	Fine to medium sand
93-103 mtr	Clay Kankar

AGL	7	0.60 mtr
		8
		50.25 mtr
	101111111111111111111111111111111111111	

2. Strata quality as per Zone Testing-

m 34-52 (1222)TDS)

58-76

(870)TDS)

ared By

Recommended By

Assistant Engineer

Approved By

62.01mtx

Executive Engineer