



GLOBAL GROUND WATER CONSULTANTS

84-III Floor, Humayunpur, Safdarjung Enclave, New Delhi - 110 029

Mobile : 9818 888 824, 9818 007 038

E-mail : srikanthchukka.c23@gamil.com, ravikanth44@yahoo.com

GEOPHYSICAL ELECTRICAL LOGGING REPORT AT

Tubewell No. :


Date : 16.04.2025.

Village : Jani Khurd

Block : Jani

District : Meerut, U.P.

Depth in Metres	Expected Litholog	Expected Water Quality
0 - 3m	Surface Soil	
3 - 12	Sandy clay	
12 - 37	Fine sand	Good
37 - 47	clay kankar	
47 - 59	Fine sand	Good
59 - 68	clay	
68 - 80	Medium to Fine sand	Good
80 - 94	clay	
94 - 110	Medium to Fine sand	Good
110 - 131	clay kankar	
131 - 145	Medium to Fine sand	Good
145 - 161	clay	
161 - 180	clay kankar	
180 - 198	Sandy clay	

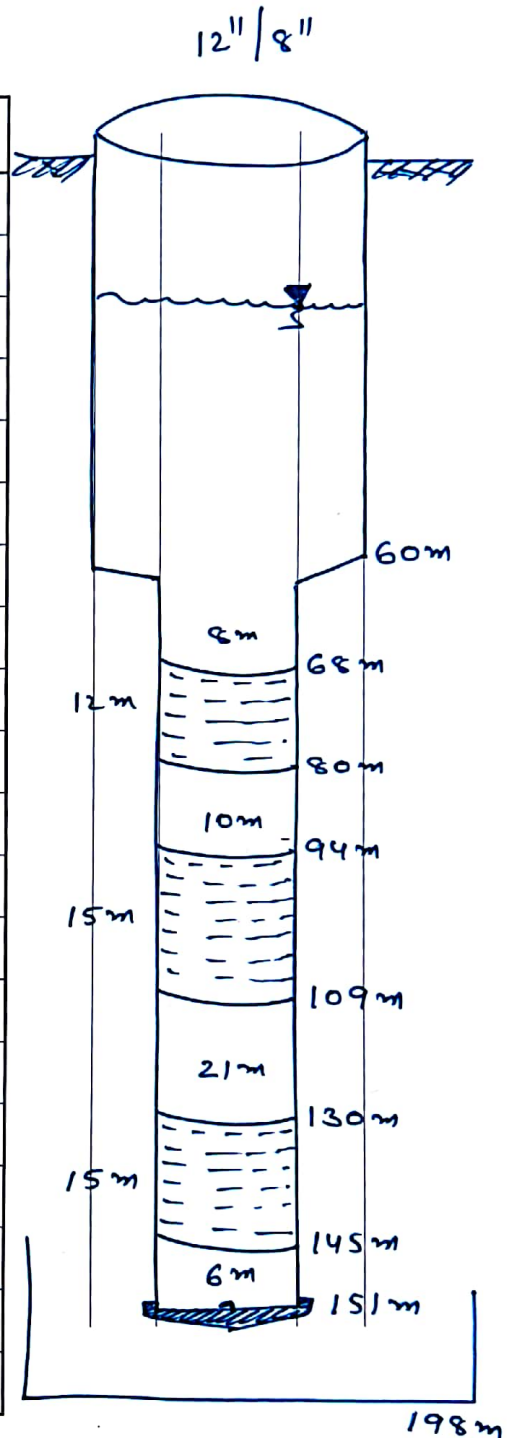

For Global Groundwater Consultants

⊗ EXPECTED WATER ZONE

▼ WATER LEVEL : METRES

Ravi Kanth
M. Ravi Kanth
16/4/2025.