



GRAM :- JAL NIGAM

Phone:- 0522 - 2620173, 2620272

UTTAR PRADESH JAL NIGAM

Ref :- _____

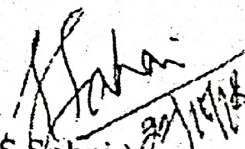
Dated :- _____

GEOPHYSICAL LOGGING REPORT

1. Name of the site:- Tarapur (Revised Report)
2. District:- Fatehpur
3. Dt. Of logging:- 17.10.18
4. Drilled depth(as reported):- 180.0 mbgl
5. Logged depth:- 165.0 mbgl
6. Logger used:- UPJN 6095
7. Logged By :- Mr. Gaurav Shukla, Asstt. Hydrogeologist
8. Based on the geophysical log interpretation following granular zones may be deciphered, particularly with respect to salinity of the formation water.

Sl. No.	Zones (mbgl)	Thickness(mts.)	Remarks
1	20.0-26.0	6.0	Good
2	29.0-34.0	5.0	Good
3	58.0-65.0	7.0	Marginal
4	110.0-117.0	7.0	Moderate to marginal
5	141.0-157.0	16.0	Moderate to marginal

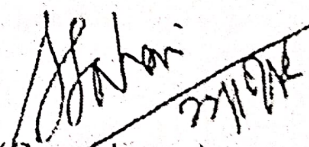
Quality of the formation water is marginal to saline between 75.0 mbgl to 106.0 mbgl.
All zones are kanker intermixed.


(Dr. S. Sahai) 22/10/18

Manager(Groundwater)

c.c.

EE. Yantrik Khand, UPJN, Allahabad for information and necessary action.


Manager(Groundwater)